

Document Information

| Document Details | | | | |
|------------------|-------------------|--|--|--|
| Issue Date | 06/05/2024 | | | |
| Revision Number | C | | | |
| Status | Issued for Review | | | |

Revision Control

| Revision Number | Change Detail | Date | Comment |
|------------------------|----------------------|------------|-------------------|
| Α | Draft issued to SRLA | 23/04/2024 | Issued for Review |
| В | Draft issued to SRLA | 29/04/2024 | Issued for Review |
| С | Draft issued to SRLA | 06/05/2024 | Issued for Review |

Contents

| Document Information | 2 |
|-----------------------------------------|----|
| Revision Control | 2 |
| Glossary | |
| Executive Summary | 5 |
| 1. Introduction | |
| 1.1. Suburban Rail Loop East | |
| 1.2. Environmental Management Framework | |
| 2. Air Quality Monitoring | |
| 2.1. Context | |
| 2.2. Purpose | |
| 2.3. Monitoring Locations | |
| 2.4 Data Limitations and Verification | |
| 3. Results | |
| 3.1. Box Hill | |
| 3.1.1. Analysis | |
| 3.2. Burwood | |
| 3.2.1. Analysis | |
| 3.4. Glen Waverley | |
| 3.4.1. Analysis | |
| 3.5. Monash | |
| 3.5.1. Analysis | |
| 3.6. Clayton | |
| 3.6.1. Analysis | |
| 3.7. Heatherton | |
| 3.7.1. Analysis | |
| 3.8. Cheltenham | |
| 3.8.1. Analysis | |
| 3.9. Meteorological Conditions | |
| 4. Quality Assurance | |
| 4.1. Data Capture | |
| 4.2. Data Validation | 27 |

Glossary

LAING O'ROURKE

 $\mu g/m^3$ – micrograms per cubic metre is a unit of measurement used to measure the mass of air pollutants (micrograms) per volume of air (cubic metre) as a concentration.

Environment Effects Statement (EES) – In Victoria, environment assessment of the potential environmental impacts or effects of a proposed development under the *Environment Effects Act 1978*.

Environmental Air Quality and Dust Management Plan (EAQDMP) – The EAQDMP is environmental management documentation prepared by the MC to manage and monitor air quality impacts during construction of SRL East. It includes the RMMP and TARP and is verified by the IEA.

Environmental Management Framework (EMF) – The purpose of the EMF is to provide a transparent and integrated framework to manage environmental effects of the SRL East Project during construction and operation to achieve acceptable environmental outcomes.

Environmental Performance Requirements (EPRs) – The EPRs define the environmental outcomes that must be achieved during the design, construction and operation of SRL East and are included within the EMF.

Environment Protection Authority (EPA) - Victorian regulator established under the *Environment Protection Act 2017* and which has the statutory objective to protect human health and the environment from the harmful effects of pollution and waste.

Environmental Reference Standard (ERS) – The ERS is a tool made under the *Environment Protection Act 2017* to identify and assess environmental values, including air quality, in Victoria.

Independent Environmental Auditor (IEA) – The IEA is appointed by the Victorian Government to undertake independent environmental reviews and audits of project activities including assessing compliance with the EMF and EPRs.

 PM_{10} – Particulate matter with an aerodynamic diameter of 10 micrometres (µm) or less. PM_{10} particles are small enough to have a potential impact on human health.

Risk Management and Monitoring Program (RMMP) – this plan outlines the approach to air quality monitoring and includes instrumental, visual monitoring, TARP and public reporting processes. The RMMP forms part of the EAQDMP.

Trigger Action Response Protocol (TARP) – The TARP defines a series of adaptive management measures that are implemented to avoid or mitigate impacts from dust emissions for nearby sensitive receptors in response to the results from monitoring. The TARP forms part of the EAQDMP.

Executive Summary

Key Outcomes

LAING O'ROURKE

Key outcomes arising from the monthly air quality monitoring program:

- In Box Hill, the TARP was implemented on three days during the reporting period. Water carts and hoses were
 used during spoil haulage, and dust was mitigated by regular street sweeping and requiring trucks to cover loads
 prior to leaving the site.
- In Burwood, the TARP was implemented on three days during the reporting period. Water carts and hoses were used during spoil haulage, and dust was mitigated by street sweeping and requiring trucks to cover loads prior to leaving the site.
- In Glen Waverley, the TARP was implemented on four days during the reporting period. Hoses were used during
 demolition works, and dust from material/spoil haulage was mitigated by street sweeping and requiring trucks to
 cover loads prior to leaving the site. Temporary exposed material stockpiles on site were covered during windy days.
- In Monash, the TARP was implemented on four days during the reporting period. A water cart and hose were used during earthworks, and soil binder was applied on exposed soil to suppress dust.
- In Clayton, the TARP was implemented on three days during the reporting period. A water cart and hose were used during demolition works, and soil binder was applied to exposed soil to suppress dust.
- In Heatherton, the TARP was implemented on one day during the reporting. A water cart was used proactively
 and reactively to suppress dust during site establishment works, and soil binder was reapplied over exposed
 surfaces.
- In Cheltenham, the TARP was not implemented during the reporting period as the monitor was commissioned to establish background conditions on 17 April 2024.

Further explanation is provided in Section 3 regarding these observations.

Purpose of the Report

This report presents the results of the monthly review of the air quality monitoring data for each Suburban Rail Loop (SRL) East Early Works construction site for the period between 19 March 2024 and 18 April 2024 in accordance with SRL East EMF and EPRs AQ1 and AQ2. Laing O'Rourke is delivering the Early Works as Managing Contractor (MC). Early Works for SRL East commenced at Burwood in May 2023, Box Hill in June 2023, Monash and Heatherton in October 2023, Clayton in December 2023, and Glen Waverley and Cheltenham in March 2024.

The MC implements an air quality monitoring program on each site that includes both visual observation and instrumental air quality monitoring. The purpose of the air quality monitors is to measure the concentration of small dust particles in the air near the construction site. These particles, known as PM_{10} , have the potential to impact human health. PM_{10} refers to particles with an aerodynamic diameter of 10 µm or less.

Measured PM₁₀ concentrations may be compared to air quality objectives that are defined in the ERS which is a tool under the *Environment Protection Act 2017*. The ERS sets out the air quality objectives for PM₁₀ which are measured over a 24hour averaging period. The objectives are risk-based concentrations that are not intended to be compliance levels, but they assist the MC to understand the risk to human health. When the instrumental monitor and/or visual observations identify a change in site conditions this prompts the MC to implement mitigations on site to reduce dust impacts, and review measures applied.

Scope of Reporting

This report does not include works delivered as SRL Initial Works. The SRL Initial Works, which include investigative works, protective works, moving underground services, ground improvement works (such as at the Stabling Facility at Heatherton) and minor road modifications were subject to a separate approval process under Clause 52.30 of the Victoria Planning Provisions (VPP) and were approved by the Minister for Planning on 19 December 2021. These works are required to comply with Clause 52.30 of the VPP and are not subject to the EMF and EPRs.

This report does not include monitoring related to asbestos containing material removal, which is monitored and reported separately.

Results

The key findings are summarised in Table 1. An analysis of these findings is provided in Section 3.

Table 1: Summary of air quality monitoring results for reporting period.

| Location | Parameter | Averaging Period | Max Concentration (µg/m³) | Median Concentration (µg/m ³) | Days TARP Implemented in the Month |
|-----------------------------------------------|-------------------------|---------------------|------------------------------|-------------------------------------------------|------------------------------------------|
| Representative Background | d ¹ | | | | |
| Alphington | PM ₁₀ | 24-hour | 59.0 | 14.7 | - |
| Dandenong | PM ₁₀ | 24-hour | 47.4 | 14.6 | - |
| Box Hill | | | | | |
| Site Office | PM ₁₀ | 24-hour | 37.0 | 16.8 | 2 |
| East of Market Street | PM10 | 24-hour | 34.8 | 19.2 | - 3 |
| Burwood | | | | | |
| Corner of McComas Grove and Sinnott Street | PM ₁₀ | 24-hour | 28.6 | 16.2 | |
| 16 McComas Grove | PM10 | 24-hour | 16.2 | 10.8 | 3 |
| Site 4 – West | PM10 | 24-hour | 26.5 | 15.0 | |
| Site 4 – East ² | PM ₁₀ | 24-hour | - | - | |
| Glen Waverley | | | | | |
| Corner of Myrtle Street and Montclair Avenue/ | PM ₁₀ | 24-hour | 29.6 | 25.1 | |
| Coleman Parade | PM ₁₀ | 24-hour | 21.9 | 15.4 | 4 |
| Site 1 North | PM10 | 24-hour | 33.9 | 13.8 | |
| Site 1 South | PM ₁₀ | 24-hour | 11.3 | 8.0 | |
| Monash | | | | | |
| Site Office | PM10 | 24-hour | 45.3 | 17.2 | 4 |
| Clayton | | | | | |
| CL69 – SiteHive 1 ³ | PM ₁₀ | 24-hour | 43.1 | 16.9 | 3 |
| Heatherton | | | | | |
| SSY - South ⁴ | PM10 | 24-hour | 50.9 | 21.8 | 1 |
| Site Office | PM10 | 24-hour | 44.2 | 22.6 | - 1 |
| Cheltenham | | | | | |
| Site Office | PM ₁₀ | 24-hour | 2.0 | 1.3 | 0 |

¹ The EPA monitoring station at Dandenong is used as the representative control site for Cheltenham and Heatherton. The EPA monitoring station at Alphington is used as the representative control site for Clayton, Monash, Glen Waverley, Burwood and Box Hill.

² Monitor stolen – no data available for the period.

³ See Section 3.6 for map of monitoring location.

⁴ See Section 3.7 for map of monitoring location.

1. Introduction

1.1. Suburban Rail Loop East

SRL will deliver a 90km rail line linking every major suburban line from the Frankston Line to the Werribee Line via Melbourne Airport, better connecting Victorians to jobs, retail, education, health services and each other. Construction of SRL East from Cheltenham to Box Hill is underway and will connect major employment, health, education and retail destinations in Melbourne's east and south-east. The new underground train line will reduce travel times, connect people travelling on the Gippsland corridor and building it will create up to 8000 direct local jobs. Trains will be running by 2035.

Early Works for SRL East commenced at Burwood in May 2023, Box Hill in June 2023, Monash and Heatherton in October 2023, and Clayton in December 2023. Laing O'Rourke is delivering the Early Works as MC. Early Works include:

- Road modifications
- Moving underground services
- Ground improvement works
- Tram terminus works, and
- Site preparations for tunnel boring machines.

This report does not include works delivered as SRL Initial Works. The SRL Initial Works, which includes investigative works, protective works, utility relocations and installations, ground improvement works (such as at the Stabling Facility at Heatherton) and minor road modifications, were subject to a separate approval process under Clause 52.30 of the VPP and were approved by the Minister for Planning on 19 December 2021. These works are required to comply with Clause 52.30 of the VPP and are not subject to the EMF and EPRs.

1.2. Environmental Management Framework

The EMF for SRL East (the Project) provides a transparent and integrated framework to manage environmental effects of the Project and includes EPRs that define environmental outcomes that must be achieved during the design, construction, and operation phases the SRL East website at <u>https://bigbuild.vic.gov.au/library/suburban-rail-loop/planning/srl-east-environmental-management-framework</u>.

The development of the EMF has been informed by relevant legislation, policy and guidelines, and the specialist impact assessment studies completed for the SRL East EES and the Minister's Assessment, dated 5 August 2022.

The EMF requires the MC to develop and implement an EAQDMP. As part of implementing this plan, the MC is required to conduct monitoring of PM₁₀ concentrations and measure wind speed and direction at each Early Works construction site and at a representative control site. The EAQDMP also includes a TARP which defines a set of triggers that prompt actions on site to reduce dust impacts, and review mitigation measures applied. The EMF, and therefore this report, is not applicable to SRL Initial Works activities.

The MC regularly reviews the monitoring data at each site, for the purpose of assessing the effectiveness of EAQDMP implementation. The verified results of the PM₁₀ monitoring for the applicable monthly period are contained in this report, which will be available to the public, in accordance with the requirements of the EMF.

2. Air Quality Monitoring

2.1. Context

Maintaining air quality is important for public health, the liveability of our cities and our environment. Overall air quality conditions in Melbourne are good, however like all major cities, there are days where the background concentrations of air pollutants are very high on a regional basis. Sometimes these elevated concentrations are due to regional influences such as windblown continental dust, bushfires or hazard reduction burns. Emissions from traffic, home heating, and industrial emissions across Melbourne can also cause high background concentrations, especially when the weather is calm. EPA monitoring stations measure these background levels of pollution that already exist in the air within the surrounding area. The EPA monitoring station at Dandenong is used as the representative control site for Heatherton and Cheltenham, and the EPA monitoring station at Alphington is used as the representative control site for all other SRL work sites.

Without effective management, construction of the Project has the potential to contribute to these background concentrations which may impact public health. Comparison of SRL East monitoring results with publicly available EPA monitoring data is used by the MC to identify when construction-related activities are impacting local air quality, and conversely when the local air quality results may be influenced by background conditions outside of the influence of the construction site.

Meteorological conditions such as wind direction and speed can impact on the dispersion of particulates in the air and by monitoring these, the MC can respond when conditions on site change. Having records of wind conditions is also helpful for retrospectively identifying the activity that is causing any elevated dust concentrations.

2.2. Purpose

The purpose of the air quality monitors is to measure the concentration of small dust particles in the air near the construction site. These particles, known as PM_{10} have the potential to impact human health. PM_{10} refers to particles with an aerodynamic diameter of 10 µm or less.

The measured concentrations are compared to air quality objectives that are defined in the ERS which is a tool under the *Environment Protection Act 2017*. The air quality objectives defined in the ERS informed the objectives for air quality for the Project, noting that the ambient air ERS is not a compliance standard that one can pollute up to. The ERS does not provide an indicator or objective for nuisance dust.

The objectives are risk-based concentrations that are not intended to be compliance levels, but they assist the MC to understand the risk to human health. The ERS sets out the air quality objectives for PM₁₀ which are measured over a 24-hour averaging period, as reproduced below in Table 2.

Table 2: Ambient air quality objectives for PM₁₀.

| Indicator | Air Quality Objective (µg/m ³) | Averaging Period |
|------------------------------------------------|--------------------------------------------|------------------|
| Particles as PM_{10} (maximum concentration) | 50 | 24-hour |

The measured concentrations (which include both existing background concentrations and the Project's incremental contribution over a 24-hour period) are presented in Section 3. Monitoring is continuous, even when there are no construction-related activities occurring on the site. Periods of time where there are no site activities are classified as 'Out of Hours'. The potential for dust generation from the work sites is much lower when there are no site activities occurring, however dust can still be generated at the work site during "Out of Hours" periods due to wind erosion.

2.3. Monitoring Locations

Air quality monitors are located on or adjacent to the Early Works construction sites, to represent local air quality conditions, in positions that enable the MC to adequately measure potential impact of works on local sensitive receivers including residents. This does not include monitoring undertaken as part of the SRL Initial Works as outlined in Section 1.1.

The air quality monitors were installed on the following dates at each of the following locations. The location of these monitors is shown on maps in Section 3 of this Report.

Table 3: Air quality monitoring locations active during reporting period.

| Monitoring Location | Date Commissioned | Coordinates | Monitoring Parameters | Representative Control Site |
|----------------------------------------------------------------|-------------------|--------------------------------------------------|--------------------------|--------------------------------------|
| Box Hill – Site Office | 07 Jul 2023 | Latitude: -37.817863° Longitude: 145.12187° | PM ₁₀ | Alphington EPA monitoring station |
| Box Hill – East of Market Street | 13 Jul 2023 | Latitude -37.818073° Longitude: 145.1232° | PM ₁₀ | Alphington EPA monitoring station |
| Burwood – 16 McComas Grove | 18 May 2023 | Latitude: -37.851494° Longitude: 145.1116° | PM ₁₀ | Alphington EPA monitoring station |
| Burwood – Site 4 – West | 16 February 2024 | Latitude: -37.850521° Longitude: 145.11009° | PM ₁₀ | Alphington EPA monitoring station |
| Burwood – Site 4 – East | 20 February 2024 | Latitude: -37.850586° Longitude: 145.11188 | PM ₁₀ | Alphington EPA monitoring station |
| Burwood – Corner of McComas Grove and Sinnott Street | 18 May 2023 | Latitude: - 37.852413° Longitude: 145.11163° | PM ₁₀ | Alphington EPA monitoring station |
| Glen Waverly - Corner of Myrtle Street and Montclair Avenue | 08 February 2024 | Latitude: -37.880742° Longitude: 145.160824° | PM ₁₀ | Alphington EPA monitoring station |
| Glen Waverley – Coleman Parade | 04 April 2024 | Latitude: -37.879701° Longitude: 145.162161° | PM ₁₀ | Alphington EPA monitoring station |
| Glen Waverley – Site 1 North | 11 March 2024 | Latitude: -37.879942° Longitude: 145.161101° | PM ₁₀ | Alphington EPA monitoring station |
| Glen Waverley – Site 1 South | 11 April 2024 | Latitude: - 37.880185° Longitude: 145.160569° | PM ₁₀ | Alphington EPA monitoring station |
| Monash – Site Office | 16 October 2023 | Latitude: -37.9024° Longitude: 145.13815° | PM ₁₀ | Alphington EPA monitoring station |
| Clayton - CL69 – SiteHive 1 | 2 December 2023 | Latitude: -37.922485 Longitude: 145.11914 | PM ₁₀ | Alphington EPA monitoring station |
| Heatherton – SSY – South | 29 May 2023 | Latitude: -37.955917° Longitude: 145.10239° | PM ₁₀ | Dandenong EPA monitoring station |
| Heatherton – SSY – Site Office | 22 January 2024 | Latitude: -37.95401° Longitude: 145.10062° | PM ₁₀ | Dandenong EPA monitoring station |
| Cheltenham - Site Office | 17 April 2024 | Latitude: -37.95605° Longitude: 145.05031° | PM ₁₀ | Dandenong EPA monitoring station |

2.4 Data Limitations and Verification

The following limitations apply to this data:

- Meteorological conditions on site can affect measurements made by monitoring devices. For instance, dust
 measurements can be impacted by rainfall, fog and/or humidity (with water droplets in the air being mistaken as
 dust particles). Displaying periods of inclement weather allows reviewers to identify measurements that may
 have been impacted.
- The monitors that measure dust concentrations and noise are located within the construction site close to the
 nearest homes. However, the measured levels at the nearest homes and beyond are usually less than what is
 measured by the monitor. This is due to the monitor being located closer to the noise and dust source, due to
 the security requirements for the monitoring equipment.

- Monitors have been placed to record air quality and airborne noise at each site, however monitors may need to be moved as works progress. Air Quality monitoring devices are located in accordance with AS/NZS 3580.1.1-2016: Methods for sampling and analysis of ambient air (the Standard). This Standard specifies that locations must be representative of the location being monitored, which in this case is offsite receptors. Specifically, Section 7 of the Standard emphasises that locations should not be unduly influenced by immediate surroundings. Locating a monitoring device too close to the works results in increased readings as the space for air quality pollutants (i.e. dust) to dissipate is not representative of emissions at the offsite receptors. Therefore, depending on the location of the works on site and the monitoring device, the device may be moved to best represent impacts to offsite receptors, while also maintaining security and safe access.
- Breaks in data availability may occur due to sensor outages, instrument errors, technical issues, or removal of sensors during non-working periods to ensure the security of the equipment.

Data are provided in tabular and graphical form in Section 3 to visually present 24-hour averages of PM₁₀ over the monthly period. The data included in this report have been verified by the MC and relevant subject matter experts.

3. Results

Data are provided in graphical form below to visually present 24-hour averages of PM_{10} dust concentration over the monthly period for each active construction site. Where the TARP has been implemented due to works occurring on the construction sites, an analysis is presented for discussion.

3.1. Box Hill



Figure 1: Box Hill air quality monitoring stations.

Table 4: Box Hill PM₁₀ results.

| Monitor Number | Monitoring Location | Max Daily PM ₁₀ Concentration (µg/m ³) | Median Daily PM ₁₀ Concentration (µg/m ³) | Days TARP Implemented in the Month |
|-------------------|-------------------------------------------|------------------------------------------------------------------|---------------------------------------------------------------------|---------------------------------------|
| - | Representative Background - Alphington | 59.0 | 14.7 | - |
| 1 | Site Office | 37.0 | 16.8 | - 3 |
| 2 | East of Market Street | 34.8 | 19.2 | - 3 |

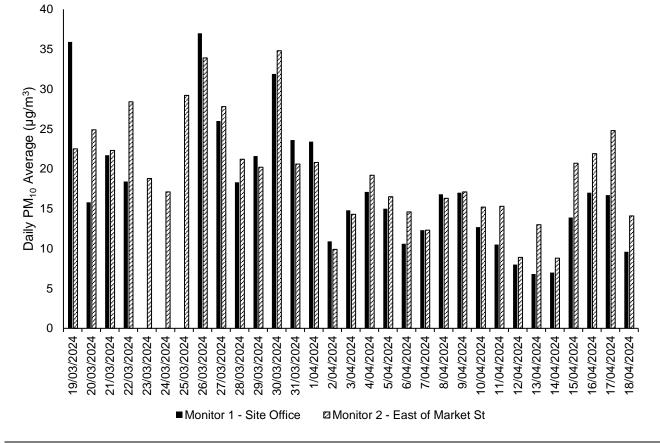


Figure 2: Box Hill PM₁₀ daily averages

3.1.1. Analysis

LAING O'ROURKE

The maximum daily average PM_{10} concentrations were 37.0 μ g/m³ (n = 31)⁵ and 34.8 μ g/m³ (n = 31)⁶ at the monitoring stations located at the Site Office (Monitor 1) and East of Market Street (Monitor 2) respectively. These daily average PM_{10} concentration readings reflect that the air quality is generally good as represented in Figure 2.

The TARP was implemented on three days during the reporting period. Dust generation from spoil haulage was mitigated by the rumble grid at Gate 4 (exiting to Whitehorse Road eastbound), street sweepers visiting the site regularly and requiring trucks to cover loads prior to leaving the site. Dust was suppressed using water carts and hoses.

Regular site inspections support this data as no dust was observed to be leaving the site boundaries. This reporting period demonstrates the MC's proactive response to dust control and maintaining air quality in the Box Hill precinct.

 $^{^{5}}$ n = the number of days of monitoring data captured in the monitoring period for Monitor 1

⁶ n = the number of days of monitoring data captured in the monitoring period for Monitor 2

3.2. Burwood

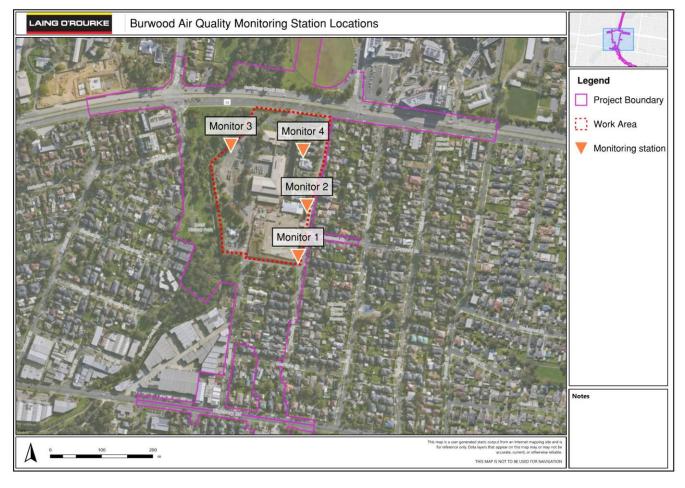


Figure 3: Burwood air quality monitoring stations.

Table 5: Burwood PM₁₀ results.

| Monitor Number | Monitoring Location | Max Daily PM ₁₀ Concentration (µg/m ³) | Median Daily PM ₁₀ Concentration (µg/m ³) | Days TARP Implemented in the Month |
|-------------------|-----------------------------------------------|------------------------------------------------------------------|---------------------------------------------------------------------|---------------------------------------|
| - | Representative Background - Alphington | 59.0 | 14.7 | - |
| 1 | Corner of McComas Grove and Sinnott Street | 28.6 | 16.2 | |
| 2 | 16 McComas Grove | 16.2 | 10.8 | - 3 |
| 3 | Site 4 – West | 26.5 | 15.0 | |
| 4 | Site 4 – East ⁷ | - | - | _ |

⁷ No data available for the period due to theft of monitor.

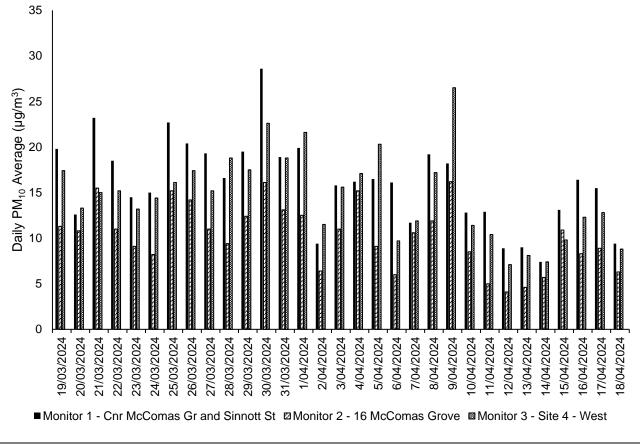


Figure 4: Burwood PM₁₀ daily averages

3.2.1. Analysis

LAING O'ROURKE

The maximum daily average PM_{10} concentrations were 28.6 µg/m³ (n = 31), 16.2 µg/m³ (n = 31), and 26.5 µg/m³ (n = 31) at the monitoring stations at the corner of McComas Grove and Sinnott Street (Monitor 1), at 16 McComas Grove (Monitor 2), and Site 4 – West (Monitor 3) respectively. Site 4 – East (Monitor 4) had no data for the entire period due to the device being stolen. A replacement device has been ordered and is awaiting delivery.

The TARP was required to be implemented on three days during the reporting period. Dust suppression activities included the use of water carts and hoses. Dust generation from spoil haulage was mitigated by requiring trucks to cover loads prior to leaving the site.

Visual air inspections support this data as no dust was observed to be leaving the site boundaries. This demonstrates the MC's proactive response to dust control and maintaining air quality in the Burwood precinct.

3.4. Glen Waverley

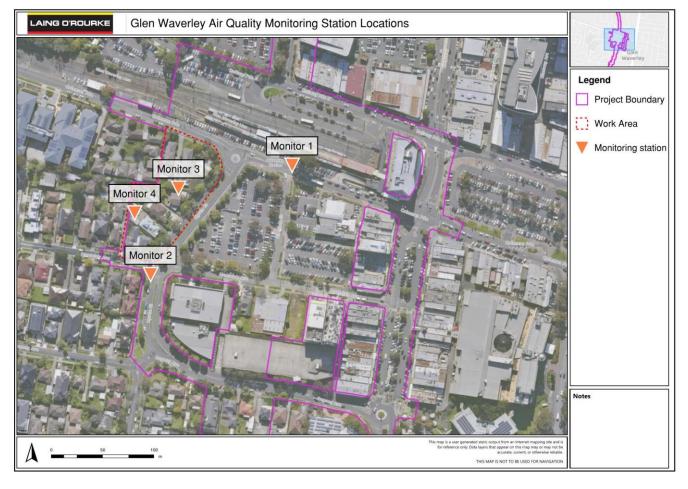


Figure 5: Glen Waverley air quality monitoring stations.

Table 6: Glen Waverley PM₁₀ results.

| Monitor Number | Monitoring Location | Max Daily PM ₁₀ Concentration (µg/m ³) | Median Daily PM ₁₀ Concentration (µg/m ³) | Days TARP Implemented in the Month |
|-------------------|-------------------------------------------------|------------------------------------------------------------------|---------------------------------------------------------------------|---------------------------------------|
| - | Representative Background - Alphington | 59.0 | 14.7 | - |
| 1 | Corner of Myrtle Street and Montclair Avenue | 29.6 | 25.1 | |
| 2 | Coleman Parade | 21.9 | 15.4 | - 4 |
| 3 | Site 1 North | 33.9 | 13.8 | _ |
| 4 | Site 1 South | 11.3 | 8.0 | |

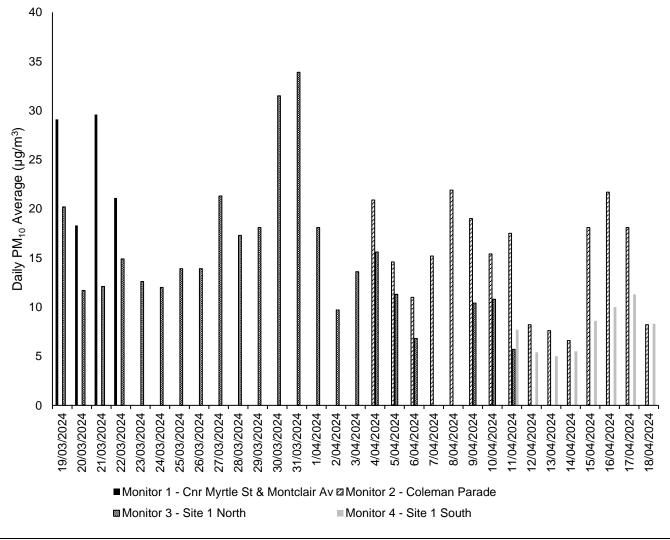


Figure 6: Burwood PM₁₀ daily averages

3.4.1. Analysis

LAING O'ROURKE

Both Initial Works and Early Works are being undertaken concurrently at Glen Waverley. The proximity of these works means there is a strong possibility Initial Works are contributory factors to air quality conditions at the site. Initial Works are not subject to the EMF.

The maximum daily average PM₁₀ concentrations were 29.6 μ g/m³ (n = 4), 21.9 μ g/m³ (n = 15), 33.9 μ g/m³ (n = 22) and 11.3 μ g/m³ (n = 8) at the monitoring stations at the corner of Myrtle Street and Montclair Avenue (Monitor 1), Coleman Parade (Monitor 2), at Site 1 North (Monitor 3), and Site 1 South (Monitor 4), respectively.

New air quality monitors were commissioned on 11 March 2024 and 11 April 2024 at Monitoring points 3 and 4, respectively, to monitor air quality during demolition works on Myrtle Street.

The TARP was implemented on four days during the reporting period. Dust generation from spoil haulage was mitigated by street sweepers visiting the site regularly and requiring trucks to cover loads prior to leaving the site. Dust was suppressed using hoses. Exposed materials such as crushed rock and soil were covered on windy days.

Visual air inspections support this data as no dust was observed to be leaving the site boundaries. This demonstrates the MC's proactive response to dust control and maintaining air quality in the Glen Waverley precinct.

3.5. Monash



Figure 7: Monash air quality monitoring stations.

Table 7: Monash PM₁₀ results.

| Monitor Number | Monitoring Location | Max Daily PM ₁₀ Concentration (µg/m ³) | Median Daily PM ₁₀ Concentration (μg/m³) | Days TARP Implemented in the Month |
|-------------------|-------------------------------------------|------------------------------------------------------------------|--------------------------------------------------------|---------------------------------------|
| - | Representative Background - Alphington | 59.0 | 14.7 | - |
| 1 | Site Office | 45.3 | 17.2 | 4 |

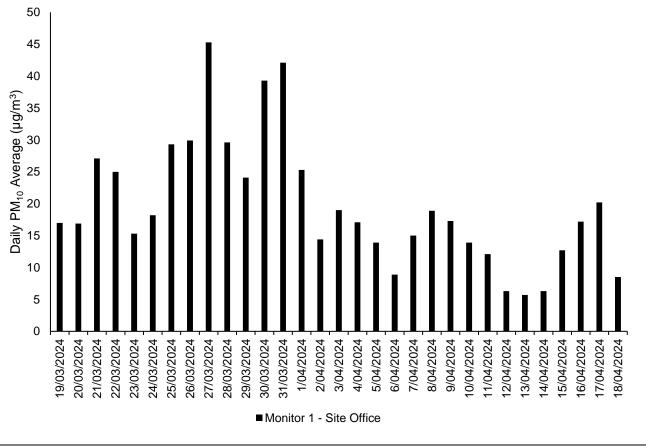


Figure 8: Monash PM₁₀ daily averages

3.5.1. Analysis

LAING O'ROURKE

The maximum daily average PM_{10} concentration was 45.3 μ g/m³ (n = 31) at the monitoring station at Site Office (Monitor 1).

The TARP was implemented on four days during the reporting period. This was a result of dry weather and the installation of fencing at the front of the site adjacent to the monitoring device. The proximity of works to the monitor resulted in an increase in peaks until the completion of those works. As proactive mitigation measures, a water cart and hose were continuously used when dust was observed. When the TARP was triggered, an additional hose was utilised to help suppress dust until levels returned to normal.

3.6. Clayton



Figure 9: Clayton air quality monitoring stations.

Table 8: Clayton PM₁₀ results.

| Monitor Number | Monitoring Location | Max Daily PM ₁₀ Concentration (µg/m ³) | Median Daily PM ₁₀ Concentration (μg/m³) | Days TARP Implemented in the Month |
|-------------------|-------------------------------------------|------------------------------------------------------------------|--------------------------------------------------------|---------------------------------------|
| - | Representative Background - Alphington | 59.0 | 14.7 | - |
| 1 | CL69 – SiteHive 1 | 43.1 | 16.9 | 3 |

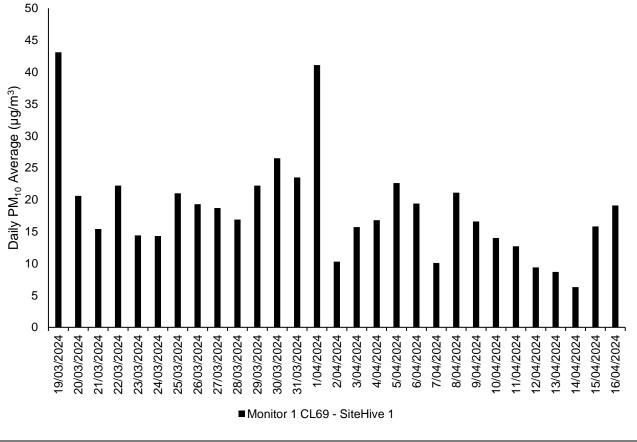


Figure 10: Clayton PM₁₀ daily averages

3.6.1. Analysis

LAING O'ROURKE

The maximum daily average PM_{10} concentration was 43.1 μ g/m³ (n = 31) at the monitoring station at CL69 SiteHive 1 (Monitor 1). These daily average PM_{10} concentration readings reflect that the air quality is generally good, as represented in Figure 8.

The TARP was implemented on three days during this reporting period. This was due to high wind speeds and exposed soil from demolition works along Clayton and Madeleine roads. Proactive measures for dust impact mitigation, when weather permitted, included hosing down the work areas prior to works commencing for the day.



3.7. Heatherton

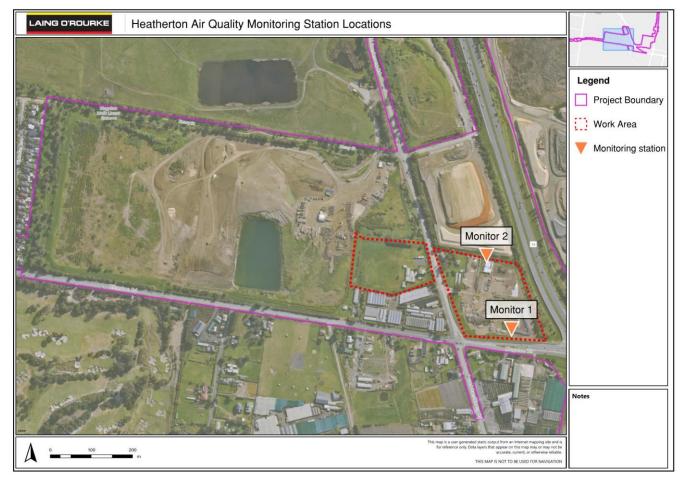


Figure 11: Heatherton air quality monitoring stations.

Table 9: Heatherton PM₁₀ results.

| Monitor Number | Monitoring Location | Max Daily PM ₁₀ Concentration (µg/m ³) | Median Daily PM ₁₀ Concentration (µg/m ³) | Days TARP Implemented in the Month |
|-------------------|------------------------------------------|------------------------------------------------------------------|---------------------------------------------------------------------|---------------------------------------|
| - | Representative Background - Dandenong | 47.4 | 14.6 | - |
| 1 | SSY - South | 50.9 | 21.8 | 1 |
| 2 | Site Office | 44.2 | 22.6 | - 1 |

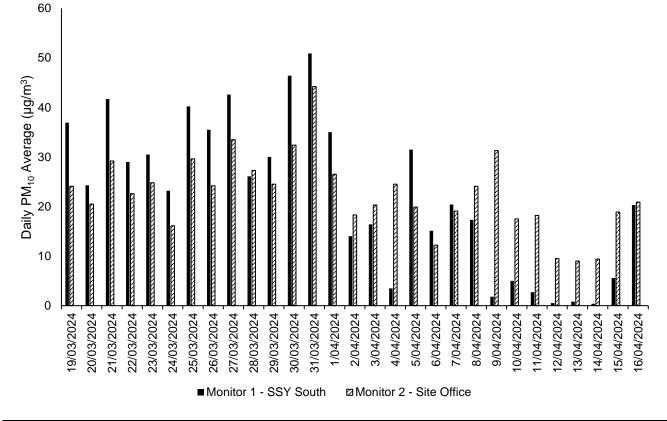


Figure 12: Heatherton PM₁₀ daily averages

3.7.1. Analysis

LAING O'ROURKE

Both Initial Works and Early Works are being undertaken concurrently at Heatherton. The proximity of these works means there is a strong possibility Initial Works are contributory factors to air quality conditions at the site. Initial Works are not subject to the EMF.

This report does not include monitoring related to asbestos removal, which is monitored and reported on separately. Monitoring for asbestos particles in the air has consistently found levels are within a safe and allowable range. Throughout this reporting period there were a range of works being undertaken at the site, some of which are not subject to the reporting requirements of this document. These included earthworks associated with site establishment and the safe removal of contaminated materials.

The maximum daily average PM₁₀ concentrations were 50.9 μ g/m³ (n = 30) and 44.2 μ g/m³ (n = 31) at the monitoring stations at SSY South (Monitor 1) and Site Office (Monitor 2). The TARP was implemented on one day during this reporting period.

The two highest readings for Monitor 1 and Monitor 2 identified above occurred during the Easter Site Shutdown Weekend. As no project works were occurring on 31 March, the reading is not representative of construction related air quality conditions at the site. A soil binding agent was resprayed over exposed surfaces and surplus stockpiles were removed prior to the shutdown.

It is further noted that the Heatherton site is located in an industrialised area with several neighbouring properties undertaking earthworks with large areas of exposed soil. On days where there is a northerly wind direction, visible airborne dust generated off-site has been observed to be blown onto the Heatherton site, contributing to elevated onsite monitoring results. This suggests project works were not the sole source of airborne dust generation in the localised area over the reporting period.

Where dust was being generated by the activities associated with the site establishment works, Level 1 and 2 TARP were triggered and appropriate dust suppression controls were employed. Over the reporting period, the water cart was used proactively and reactively to reduce dust. A soil binding agent was resprayed over exposed surfaces. The location of monitoring devices in proximity to work areas and receptors has also been assessed.

Note, as demolition has concluded at the 217 Kingston Rdlocation, Monitor 3 has been decommissioned and removed from site with no data captured during this monitoring period.

3.8. Cheltenham



Figure 13: Cheltenham air quality monitoring stations.

Table 10: Cheltenham PM₁₀ results.

| Monitor Number | Monitoring Location | Max Daily PM ₁₀ Concentration (µg/m ³) | Median Daily PM ₁₀ Concentration (μg/m ³) | Days TARP Implemented in the Month | |
|-------------------|------------------------------------------|------------------------------------------------------------------|---------------------------------------------------------------------|---------------------------------------|--|
| - | Representative Background - Dandenong | 47.4 | 14.6 | - | |
| 1 | Site Office | 2.0 | 1.3 | 0 | |

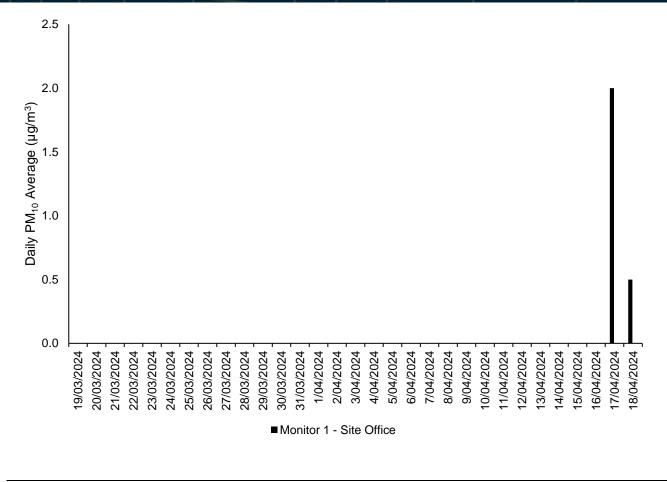


Figure 14: Cheltenham PM₁₀ daily averages

3.8.1. Analysis

LAING O'ROURKE

The maximum daily average PM_{10} concentration was $2 \mu g/m^3$ (n = 2) at the monitoring station at the Site Office (Monitor 1). Works were not occurring during the reporting period and the SiteHive monitoring location was implemented to establish background conditions at the Cheltenham site. The TARP was not implemented during the reporting period.

3.9. Meteorological Conditions

Table 11: Daily weather observations for Melbourne (Olympic Park), Victoria 19 March 2024 – 18 April 2024. Data Source BOM.

| Statistic | Min Temperature (°C) | Max Temperature (°C) | Maximum Wind Gust Direction | Maximum Wind Gust Speed (km/h) | Relative Humidity @ 9:00 AM (%) |
|-----------|-------------------------|-------------------------|--------------------------------|-----------------------------------|------------------------------------|
| Mean | 16.1 | 26.7 | - | - | 65.5 |
| Lowest | 10.8 | 16.9 | SE | 22 | 35.0 |
| Highest | 22.8 | 37.6 | Ν | 57 | 92.0 |

Table 12: Daily rain data for Melbourne (Olympic Park), Victoria 19 March 2024 –18 April 2024. Data Source BOM.

| Statistic | Rain (mm) | |
|------------|-----------|--|
| Daily Low | 0.0 | |
| Daily High | 4.0 | |
| Total | 9.4 | |



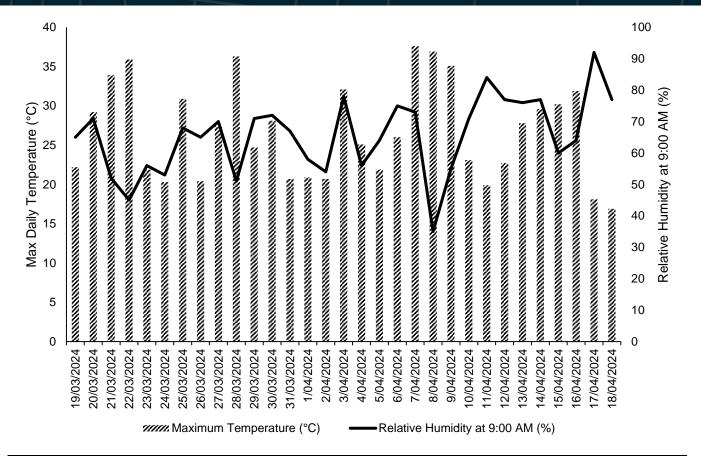


Figure 15: Daily relative humidity and temperature observations for Melbourne (Olympic Park), Victoria 19 March 2024 – 18 April 2024. Data Source BOM.

LAING O'ROURKE

4. Quality Assurance

4.1. Data Capture

Data capture is defined as the number of valid data periods collected divided by the number of available data periods. Valid data excludes period where the instrument is unavailable due to calibration and maintenance and excludes periods where the data has been rejected due to quality assurance/data validation procedures.

Data capture statistics for the reporting period 19 March 2024 to 18 April 2024 are shown in Table 13.

Data capture statistics were 100% for all parameters at all stations for the reporting period, except for the following:

- At Box Hill, the Site Office monitor went offline on 23 March 2024 for three days due to a technical error with the solar controller. A replacement component was installed on 26 March 2024. There have been no further issues with this monitoring station following the repair.
- At Burwood, the Site 4 East monitor was stolen on 10 March 2024. A replacement unit is being procured.
- At Glen Waverley, the Montclair/Myrtle monitor was decommissioned following the completion of IW power works at the Montclair/Myrtle works extent. The same Hexanode monitor (HEX-000477) was commissioned on Coleman Parade to monitor the IW power works along the Coleman Parade works extent. The Site 1 North monitoring point has experienced issues with charging of the battery. A lithium battery charger has been ordered with SiteHive and will be reimplemented as soon as possible.
- At Heatherton, the SSY- South monitor fell over during a wind gust on 4 April 2024 and was subsequently damaged. This event resulted in sporadic data capture throughout the rest of the reporting period from 4 April 2024. A replacement unit has since been ordered and installed.

Table 13: Air quality monitoring, data capture summary

| Location | Parameter | Averaging Period | Collected Periods | Available Periods | Data Capture |
|---------------------------------------------------------|-------------------------|------------------|--------------------------|-------------------|--------------|
| Box Hill – Site Office | PM ₁₀ | 24-hours | 28 | 31 | 90% |
| Box Hill – East of Market Street | PM10 | 24-hours | 31 | 31 | 100% |
| Burwood – 16 McComas Grove | PM ₁₀ | 24-hours | 31 | 31 | 100% |
| Burwood – Corner of McComas Grove and Sinnott Street | PM10 | 24-hours | 31 | 31 | 100% |
| Burwood – Site 4 - West | PM10 | 24-hours | 31 | 31 | 100% |
| Burwood – Site 4 - East | PM10 | 24-hours | - | 31 | - |
| Glen Waverley - Corner Myrtle St & Montclair Avenue | PM10 | 24-hours | 29 | 31 | 94% |
| Glen Waverley – Coleman Parade | PM ₁₀ | 24-hours | 15 | 15 | 100% |
| Glen Waverley – Site 1 North | PM10 | 24-hours | 22 | 31 | 71% |
| Glen Waverley – Site 1 South | PM ₁₀ | 24-hours | 8 | 8 | 100% |
| Monash – Site Office | PM10 | 24-hours | 31 | 31 | 100% |
| Clayton - CL69 – SiteHive 1 | PM ₁₀ | 24-hours | 31 | 31 | 100% |
| Heatherton – SSY – South | PM10 | 24-hours | 30 | 31 | 96% |
| Heatherton – SSY – Site Office | PM10 | 24-hours | 31 | 31 | 100% |
| Cheltenham – Site Office | PM ₁₀ | 24-hours | 2 | 2 | 100% |

4.2. Data Validation

Data contained in this report has been validated against performance and calibration requirements for each instrument.

Table 14: Monitoring device calibration information.

| Location | Device Serial Number | Calibration Date | Calibration Due |
|-------------------------------------------------------------|----------------------|------------------|-----------------|
| Box Hill – Site Office | HEX-000407 | 29 Aug 2023 | 29 Aug 2025 |
| Box Hill – East of Market Street | HEX-000339 | 19 Apr 2023 | 19 Apr 2025 |
| Burwood – 16 McComas Grove | HEX-000385 | 29 Aug 2023 | 29 Aug 2025 |
| Burwood – Corner of McComas Grove and Sinnott Street | HEX-000308 | 03 Apr 2023 | 03 Apr 2025 |
| Burwood – Site 4 - East | HEX-000487 | 12 Dec 2023 | 12 Dec 2025 |
| Burwood – Site 4 - West | HEX-000489 | 06 Dec 2023 | 06 Dec 2025 |
| Glen Waverly - Corner of Myrtle Street and Montclair Avenue | HEX-000477 | 12 Dec 2023 | 12 Dec 2025 |
| Glen Waverley – Coleman Parade | HEX-000477 | 12 Dec 2023 | 12 Dec 2025 |
| Glen Waverley – Site 1 North | HEX-000319 | 04 Mar 2024 | 04 Mar 2026 |
| Glen Waverley – Site 1 South | HEX-000490 | 12 Dec 2023 | 12 Dec 2025 |
| Monash – Site Office | HEX-000418 | 29 Aug 2023 | 29 Aug 2025 |
| Clayton - CL69 – SiteHive 1 | HEX-000139 | 22 Nov 2023 | 22 Nov 2025 |
| Heatherton – SSY – South | HEX-000050 | 21 Apr 2023 | 21 Apr 2025 |
| Heatherton – SSY – Site Office | HEX-000317 | 13 Dec 2023 | 13 Dec 2025 |
| Cheltenham – Site Office | HEX-000482 | 12 Dec 2023 | 12 Dec 2025 |