

# Air Quality Monthly Report Early Works Tunnels South

19 May – 18 June 2025









# Introduction

This summary report presents the results of the monthly air quality monitoring data for the construction of SRL East. Laing O'Rourke (LOR) is delivering the Early Works (EW) as Managing Contractor (MC) and Suburban Connect is delivering the Tunnels South works as Principal Contractor (PC). The two delivery partners have individually prepared reports to comply with the Environmental Performance Requirement (EPR) for Air Quality.

SRL East Early Works include road modifications, moving underground services, ground improvement works, tram terminus works, and site preparations for tunnel boring machines.


SRL East Tunnels South is a fully tunnelled metro corridor between Cheltenham and Glen Waverley. The delivery scope encompasses station boxes and twin segmentally lined bored tunnels with cross passages.

# **Appendices**

Appendix 1 – Suburban Rail Loop East Early Works Air Quality Monthly Report

Appendix 2 - Suburban Rail Loop East Tunnels South Air Quality Monthly Report











### **Document Information**

<b>Document Details</b>	
Issue Date	27/06/2025
<b>Revision Number</b>	С
Status	Issued for Review

### **Revision Control**

Revision Number	Change Detail	Date	Comment
A	Draft issued to SRLA	23/06/2025	Issued for Review
В	Draft issued to SRLA	27/06/2025	Issued for Review
С	Draft issued to SRLA	9/07/2025	Issued for Review



# **Contents**

Doc	cument Information	2
Rev	vision Control	2
Glo	ossary	4
Exe	ecutive Summary	5
1.	Introduction	6
1.1.		
1.2.	. Environmental Management Framework	7
2.	Air Quality Monitoring	8
2.1.	. Context	8
2.2.	. Purpose	8
2.3.	. Monitoring Locations	9
2.4		
3.	Results	
3.1.		
	3.1.1. Analysis	
3.2.		
	3.2.1. Analysis	
3.3.		
	3.3.1. Analysis	
3.4.		
3.5.	•	
3.6.		
	3.6.1. Analysis	
3.7.		
4. -	Meteorological Conditions	
5.	Quality Assurance	
5.1.		
5.2.	Data Validation	



### **Glossary**

**μg/m³** – micrograms per cubic metre is a unit of measurement used to measure the mass of air pollutants (micrograms) per volume of air (cubic metre) as a concentration.

**Environment Effects Statement (EES)** – In Victoria, environment assessment of the potential environmental impacts or effects of a proposed development under the *Environment Effects Act 1978*.

**Environmental Air Quality and Dust Management Plan (EAQDMP)** – The EAQDMP is environmental management documentation prepared by the MC to manage and monitor air quality impacts during construction of SRL East. It includes the RMMP and TARP and is verified by the IEA.

**Environmental Management Framework (EMF)** – The purpose of the EMF is to provide a transparent and integrated framework to manage environmental effects of the SRL East Project during construction and operation to achieve acceptable environmental outcomes.

**Environmental Performance Requirements (EPRs) –** The EPRs define the environmental outcomes that must be achieved during the design, construction and operation of SRL East and are included within the EMF.

**Environment Protection Authority (EPA) -** Victorian regulator established under the *Environment Protection Act 2017* and which has the statutory objective to protect human health and the environment from the harmful effects of pollution and waste.

**Environmental Reference Standard (ERS)** – The ERS is a tool made under the *Environment Protection Act 2017* to identify and assess environmental values, including air quality, in Victoria.

**Independent Environmental Auditor (IEA)** – The IEA is appointed by the Victorian Government to undertake independent environmental reviews and audits of project activities including assessing compliance with the EMF and EPRs.

 $PM_{10}$  – Particulate matter with an aerodynamic diameter of 10 micrometres ( $\mu$ m) or less.  $PM_{10}$  particles are small enough to have a potential impact on human health.

**Risk Management and Monitoring Program (RMMP)** – this plan outlines the approach to air quality monitoring and includes instrumental, visual monitoring, TARP and public reporting processes. The RMMP forms part of the EAQDMP.

**Trigger Action Response Protocol (TARP) –** The TARP defines a series of adaptive management measures that are implemented to avoid or mitigate impacts from dust emissions for nearby sensitive receptors in response to the results from monitoring. The TARP forms part of the EAQDMP.

4



### **Executive Summary**

### **Key Outcomes**

Key outcomes arising from the monthly air quality monitoring program:

- In Box Hill, the TARP was not implemented during the reporting period. Water carts and hoses were used during site establishment works, and dust was reduced by street sweeping and requiring trucks to cover loads prior to leaving the site.
- In Burwood, the TARP was not implemented during the reporting period. Water carts and hoses were used during material and spoil haulage, wetting of exposed surfaces and stockpiles, and dust was reduced by street sweeping and requiring trucks to cover loads prior to leaving the site.
- In Glen Waverley, the TARP was not implemented during the reporting period. This is due to proactive dust mitigation measures such as the usage of water carts and hoses during material and spoil haulage. Dust was reduced by street sweeping and requiring trucks to cover loads prior to leaving the site.
- In Monash, all Early Works are complete, and all monitors have been decommissioned.
- In Clayton, all Early Works are complete, and all monitors have been decommissioned.
- In Heatherton, the TARP was implemented on one day during the reporting period. Water carts and hoses
  were used during excavation, and material and spoil haulage. Dust was reduced by street sweeping and
  requiring trucks to cover loads prior to leaving the site.
- In Cheltenham, all Early Works are complete, and all monitors have been decommissioned.

Further explanation is provided in Section 3 regarding these observations.

### **Purpose of the Report**

This report presents the results of the monthly review of the air quality monitoring data for each Suburban Rail Loop (SRL) East Early Works construction site for the period between 19 May 2025 and 18 June 2025 in accordance with SRL East EMF and EPRs AQ1 and AQ2. Laing O'Rourke is delivering the Early Works as Managing Contractor (MC). Early Works for SRL East commenced at Burwood in May 2023, Box Hill in June 2023, Monash and Heatherton in October 2023, Clayton in December 2023, and Glen Waverley and Cheltenham in March 2024.

The MC implements an air quality monitoring program on each site that includes both visual observation and instrumental air quality monitoring. The purpose of the air quality monitors is to measure the concentration of small dust particles in the air near the construction site. These particles, known as  $PM_{10}$ , have the potential to impact human health.  $PM_{10}$  refers to particles with an aerodynamic diameter of 10  $\mu$ m or less.

Measured PM<sub>10</sub> concentrations may be compared to air quality objectives that are defined in the ERS which is a tool under the *Environment Protection Act 2017*. The ERS sets out the air quality objectives for PM<sub>10</sub> which are measured over a 24-hour averaging period. The objectives are risk-based concentrations that are not intended to be compliance levels, but they assist the MC to understand the risk to human health. When the instrumental monitor and/or visual observations identify a change in site conditions this prompts the MC to implement mitigations on site to reduce dust impacts, and review measures applied.

### Scope of Reporting

This report does not include works delivered as SRL Initial Works. The SRL Initial Works, which include investigative works, protective works, moving underground services, ground improvement works (such as at the Stabling Facility at Heatherton) and minor road modifications were subject to a separate approval process under Clause 52.30 of the Victoria Planning Provisions (VPP) and were approved by the Minister for Planning on 19 December 2021. These works are required to comply with Clause 52.30 of the VPP and are not subject to the EMF and EPRs.

This report does not include monitoring related to asbestos containing material removal, which is monitored and reported separately.



### Results

The key findings are summarised in Table 1. An analysis of these findings is provided in Section 3.

Table 1: Summary of air quality monitoring results for reporting period.

Location Parameter		Averaging Period	Max Concentration (μg/m³)	Median Concentration (μg/m³)	Days TARP Implemented in the Month
Representative Background	d <sup>1</sup>				
Alphington	PM <sub>10</sub>	24-hour	40.8	15.6	-
Dandenong	PM <sub>10</sub>	24-hour	37.8	15.4	-
Box Hill					
Site Office	PM <sub>10</sub>	24-hour	33.7	11.6	0
Burwood					
Corner of McComas Grove and Sinnott Street	PM <sub>10</sub>	24-hour	34.0	13.6	
16 McComas Grove	PM <sub>10</sub>	24-hour	28.1	9.1	
Site 4 – East	PM <sub>10</sub>	24-hour	21.2	10.1	0
Site 4 – West	PM <sub>10</sub>	24-hour	27.3	11.6	
Site 1 – South	PM <sub>10</sub>	24-hour	45.9	15.3	_
Glen Waverley					
Coleman Parade	PM <sub>10</sub>	24-hour	41.5	18.6	0
Railway Parade	PM <sub>10</sub>	24-hour	24.6	17.8	<del>-</del> 0
Heatherton					
SSY - South	PM <sub>10</sub>	24-hour	60.0	17.2	
Site Office	PM <sub>10</sub>	24-hour	28.0	12.0	1
SS17	PM <sub>10</sub>	24-hour	29.8	11.9	

# 1. Introduction

### 1.1. Suburban Rail Loop East

SRL will deliver a 90km rail line linking every major suburban line from the Frankston Line to the Werribee Line via Melbourne Airport, better connecting Victorians to jobs, retail, education, health services and each other. Construction of SRL East from Cheltenham to Box Hill is underway and will connect major employment, health, education and retail destinations in Melbourne's east and south-east. The new underground train line will reduce travel times, and connect people travelling on the Gippsland corridor. Construction of SRL East is creating up to 8000 direct local jobs, with trains to be running in 2035.

Early Works for SRL East commenced at Burwood in May 2023, Box Hill in June 2023, Monash and Heatherton in October 2023, Clayton in December 2023, Glen Waverley and Cheltenham in March 2024. Laing O'Rourke is delivering the Early Works as MC. Early Works include:

https://www.epa.vic.gov.au/for-community/airwatch

-

<sup>&</sup>lt;sup>1</sup> The EPA monitoring station at Dandenong is used as the representative control site for Heatherton. The EPA monitoring station at Alphington is used as the representative control site for Cheltenham, Clayton, Monash, Glen Waverley, Burwood and Box Hill.



- Road modifications
- Moving underground services
- Ground improvement works
- Tram terminus works, and
- Site preparations for tunnel boring machines.

This report does not include works delivered as SRL Initial Works. The SRL Initial Works, which includes investigative works, protective works, utility relocations and installations, ground improvement works (such as at the Stabling Facility at Heatherton) and minor road modifications, were subject to a separate approval process under Clause 52.30 of the VPP and were approved by the Minister for Planning on 19 December 2021. These works are required to comply with Clause 52.30 of the VPP and are not subject to the EMF and EPRs.

### 1.2. Environmental Management Framework

The EMF for SRL East (the Project) provides a transparent and integrated framework to manage environmental effects of the Project and includes EPRs that define environmental outcomes that must be achieved during the design, construction, and operation phases the SRL East website at <a href="https://bigbuild.vic.gov.au/library/suburban-rail-loop/planning/srl-east-environmental-management-framework">https://bigbuild.vic.gov.au/library/suburban-rail-loop/planning/srl-east-environmental-management-framework</a>.

The development of the EMF has been informed by relevant legislation, policy and guidelines, and the specialist impact assessment studies completed for the SRL East EES and the Minister's Assessment, dated 5 August 2022.

The EMF requires the MC to develop and implement an EAQDMP. As part of implementing this plan, the MC is required to conduct monitoring of PM<sub>10</sub> concentrations and measure wind speed and direction at each Early Works construction site and at a representative control site. The EAQDMP also includes a TARP which defines a set of triggers that prompt actions on site to reduce dust impacts, and review mitigation measures applied. The EMF, and therefore this report, is not applicable to SRL Initial Works activities.

The MC regularly reviews the monitoring data at each site, for the purpose of assessing the effectiveness of EAQDMP implementation. The verified results of the  $PM_{10}$  monitoring for the applicable monthly period are contained in this report, which will be available to the public, in accordance with the requirements of the EMF.

7



# 2. Air Quality Monitoring

### 2.1. Context

Maintaining air quality is important for public health, the liveability of our cities and our environment. Overall air quality conditions in Melbourne are good, however like all major cities, there are days where the background concentrations of air pollutants are very high on a regional basis. Sometimes these elevated concentrations are due to regional influences such as windblown continental dust, bushfires or hazard reduction burns. Emissions from traffic, home heating, and industrial emissions across Melbourne can also cause high background concentrations, especially when the weather is calm. EPA monitoring stations measure these background levels of pollution that already exist in the air within the surrounding area. The EPA monitoring station at Dandenong is used as the representative control site for Heatherton and Cheltenham, and the EPA monitoring station at Alphington is used as the representative control site for all other SRL work sites.

Without effective management, construction of the Project has the potential to contribute to these background concentrations which may impact public health. Comparison of SRL East monitoring results with publicly available EPA monitoring data is used by the MC to identify when construction-related activities are impacting local air quality, and conversely when the local air quality results may be influenced by background conditions outside of the influence of the construction site.

Meteorological conditions such as wind direction and speed can impact on the dispersion of particulates in the air and by monitoring these, the MC can respond when conditions on site change. Having records of wind conditions is also helpful for retrospectively identifying the activity that is causing any elevated dust concentrations.

### 2.2. Purpose

The purpose of the air quality monitors is to measure the concentration of small dust particles in the air near the construction site. These particles, known as  $PM_{10}$  have the potential to impact human health.  $PM_{10}$  refers to particles with an aerodynamic diameter of  $10 \, \mu m$  or less.

The measured concentrations are compared to air quality objectives that are defined in the ERS which is a tool under the *Environment Protection Act 2017*. The air quality objectives defined in the ERS informed the objectives for air quality for the Project, noting that the ambient air ERS is not a compliance standard that one can pollute up to. The ERS does not provide an indicator or objective for nuisance dust.

The objectives are risk-based concentrations that are not intended to be compliance levels, but they assist the MC to understand the risk to human health. The ERS sets out the air quality objectives for PM<sub>10</sub> which are measured over a 24-hour averaging period, as reproduced below in Table 2.

Table 2: Ambient air quality objectives for PM<sub>10</sub>.

Indicator	Air Quality Objective (µg/m³)	Averaging Period
Particles as PM <sub>10</sub> (maximum concentration)	50	24-hour

The measured concentrations (which include both existing background concentrations and the Project's incremental contribution over a 24-hour period) are presented in Section 3. Monitoring is continuous, even when there are no construction-related activities occurring on the site. Periods of time where there are no site activities are classified as 'Out of Hours'. The potential for dust generation from the work sites is much lower when there are no site activities occurring, however dust can still be generated at the work site during "Out of Hours" periods due to wind erosion.



# 2.3. Monitoring Locations

Air quality monitors are located on or adjacent to the Early Works construction sites, to represent local air quality conditions, in positions that enable the MC to adequately measure potential impact of works on local sensitive receivers including residents. This does not include monitoring undertaken as part of the SRL Initial Works as outlined in Section 1.1.

The air quality monitors were installed on the following dates at each of the following locations. The location of these monitors is shown on maps in Section 3 of this Report.

Table 3: Air quality monitoring locations active during reporting period.

Monitoring Location	Date Commissioned	Coordinates	Monitoring Parameters	Representative Control Site
Box Hill – Site Office	07 Jul 2023	Latitude: -37.817863° Lo 145.12187°	PM <sub>10</sub>	Alphington EPA monitoring station
Burwood – 16 McComas Grove	18 May 2023	Latitude: -37.851494° Longitude: 145.1116°	PM <sub>10</sub>	Alphington EPA monitoring station
Burwood – Site 4 – West	16 February 2024	Latitude: -37.850521° Longitude: 145.11009°	PM <sub>10</sub>	Alphington EPA monitoring station
Burwood – Site 4 – East	20 February 2024	Latitude: -37.850586° Longitude: 145.11188	PM <sub>10</sub>	Alphington EPA monitoring station
Burwood – Corner of McComas Grove and Sinnott Street	18 May 2023	Latitude: - 37.852413° Longitude: 145.11252°	PM <sub>10</sub>	Alphington EPA monitoring station
Burwood – Site 1 South	08 May 2024	Latitude: -37.8549° Longitude: 145.10995°	PM <sub>10</sub>	Alphington EPA monitoring station
Glen Waverley – Railway Parade	09 August 2024	Latitude: -37.878888° Longitude: 145.161078°	PM <sub>10</sub>	Alphington EPA monitoring station
Glen Waverley – Coleman Parade	19 August 2024	Latitude: -37.880739° Longitude: 145.160738°	PM <sub>10</sub>	Alphington EPA monitoring station
Heatherton – SSY – South	29 May 2023	Latitude: -37.955917° Longitude: 145.10239°	PM <sub>10</sub>	Dandenong EPA monitoring station
Heatherton – SSY – Site Office	22 January 2024	Latitude: -37.95401° Longitude: 145.10062°	PM <sub>10</sub>	Dandenong EPA monitoring station
Heatherton – SSY – SS17	26 March 2025	Latitude: -37.9544° Longitude: 145.0975°	PM <sub>10</sub>	Dandenong EPA monitoring station



### 2.4 Data Limitations and Verification

The following limitations apply to this data:

- Meteorological conditions on site can affect measurements made by monitoring devices. For instance, dust
  measurements can be impacted by rainfall, fog and/or humidity (with water droplets in the air being mistaken as
  dust particles). Displaying periods of inclement weather allows reviewers to identify measurements that may
  have been impacted.
- The monitors that measure dust concentrations and noise are located within the construction site close to the
  nearest homes. However, the measured levels at the nearest homes and beyond are usually less than what is
  measured by the monitor. This is due to the monitor being located closer to the source, due to the security
  requirements for the monitoring equipment.
- Monitors have been placed to record air quality and airborne noise at each site, however monitors may need to be moved as works progress. Air Quality monitoring devices are located in accordance with AS/NZS 3580.1.1-2016: Methods for sampling and analysis of ambient air (the Standard). This Standard specifies that locations must be representative of the location being monitored, which in this case is offsite receptors. Specifically, Section 7 of the Standard emphasises that locations should not be unduly influenced by immediate surroundings. Locating a monitoring device too close to the works results in increased readings as the space for air quality pollutants (i.e. dust) to dissipate is not representative of emissions at the offsite receptors. Therefore, depending on the location of the works on site and the monitoring device, the device may be moved to best represent impacts to offsite receptors, while also maintaining security and safe access.
- Breaks in data availability may occur due to sensor outages, instrument errors, technical issues, or removal of sensors during non-working periods to ensure the security of the equipment.

Data are provided in tabular and graphical form in Section 3 to visually present 24-hour averages of  $PM_{10}$  over the monthly period. The data included in this report have been verified by the MC and relevant subject matter experts.



# 3. Results

Data is provided in graphical form below to visually present 24-hour averages of  $PM_{10}$  dust concentration over the monthly period for each active construction site. Where the TARP has been implemented due to works occurring on the construction sites, an analysis is presented for discussion.

### 3.1. Box Hill

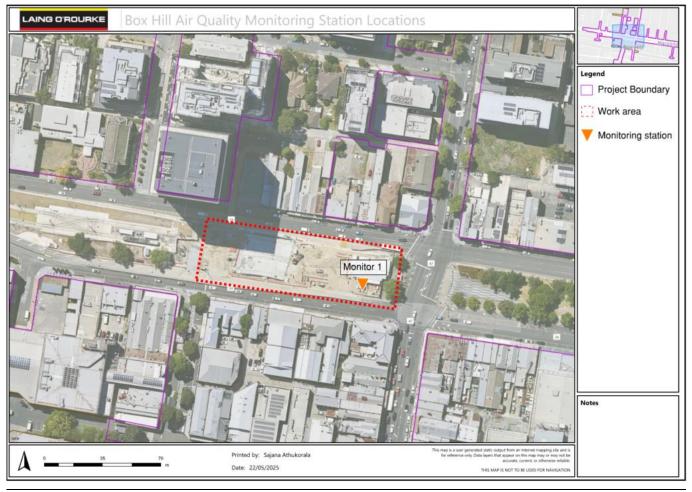


Figure 1: Box Hill air quality monitoring stations.

Table 4: Box Hill PM<sub>10</sub> results.

Monitor Number	Monitoring Location	Max Daily PM₁₀ Concentration (μg/m³)	Median Daily PM₁₀ Concentration (µg/m³)	Days TARP Implemented in the Month
-	Representative Background - Alphington	40.8	15.6	-
1	Site Office	33.7	11.6	0

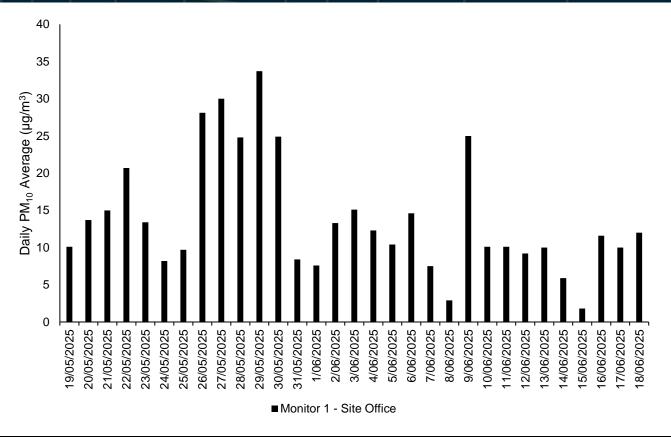


Figure 2: Box Hill PM<sub>10</sub> daily averages.

### 3.1.1. Analysis

The maximum daily average  $PM_{10}$  concentration was 33.7  $\mu$ g/m<sup>3</sup> (n = 31) at the Site Office (Monitor 1) monitoring station.

The TARP was not implemented during the reporting period. Dust generated from site establishment works were proactively suppressed using water carts and hoses. The proactive use of hoses on exposed surfaces ensured dust levels were managed. Additional dust management measures conducted on site included ensuring trucks covered their loads prior to leaving site during spoil haulage.



# 3.2. Burwood

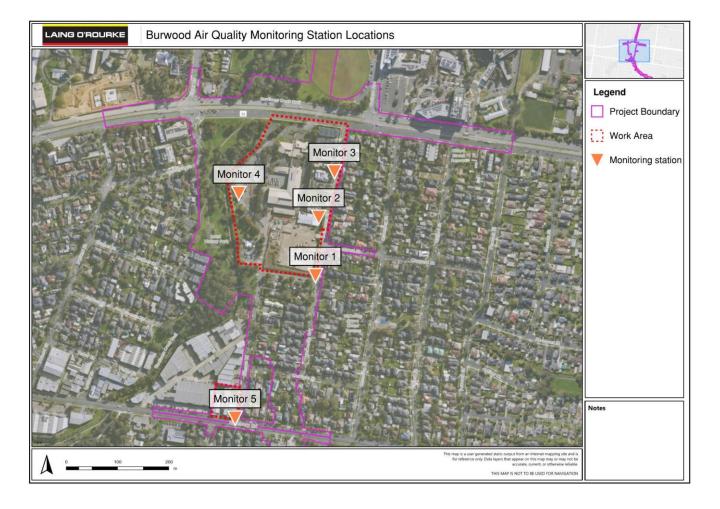


Figure 3: Burwood air quality monitoring stations.

Table 5: Burwood PM<sub>10</sub> results.

Monitor Number	Monitoring Location	Max Daily PM <sub>10</sub> Concentration (µg/m³)	Median Daily PM <sub>10</sub> Concentration (µg/m³)	Days TARP Implemented in the Month
-	Representative Background - Alphington	40.8 15.6		-
1	Corner of McComas Grove and Sinnott Street	34.0	13.6	_
2	16 McComas Grove	28.1	9.1	_
3	Site 4 - East	21.2	10.1	0
4	Site 4 – West	27.3	11.6	_
5	Site 1 – South	45.9	15.3	_

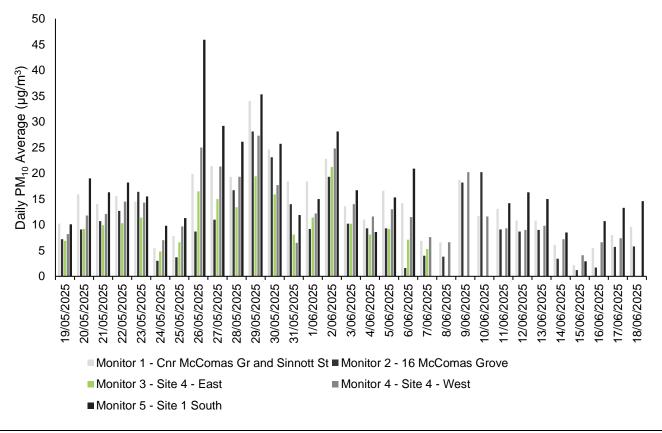


Figure 4: Burwood PM<sub>10</sub> daily averages.

### 3.2.1. Analysis

The maximum daily average  $PM_{10}$  concentrations reported at the Burwood monitoring stations were 34.0  $\mu g/m^3$  (n = 31) at the corner of McComas Grove and Sinnott Street (Monitor 1), 28.1  $\mu g/m^3$  (n = 31) at 16 McComas Grove (Monitor 2), 21.2  $\mu g/m^3$  (n = 20) at Site 4 – East (Monitor 3), 27.3  $\mu g/m^3$  (n = 30) at Site 4 – West (Monitor 4), and 45.9  $\mu g/m^3$  (n = 27) at Site 1 South (Monitor 5).

The TARP was not implemented during the reporting period. Water carts and hoses were used proactively to manage dust. Other dust management measures implemented on site included trucks covering loads prior to leaving site during spoil haulage. Stockpiles of soil were maintained below the top of the hoarding to minimise the risk of dust leaving the site. Additionally, stockpiles and exposed surfaces were routinely dampened during worktimes to prevent dust.



# 3.3. Glen Waverley

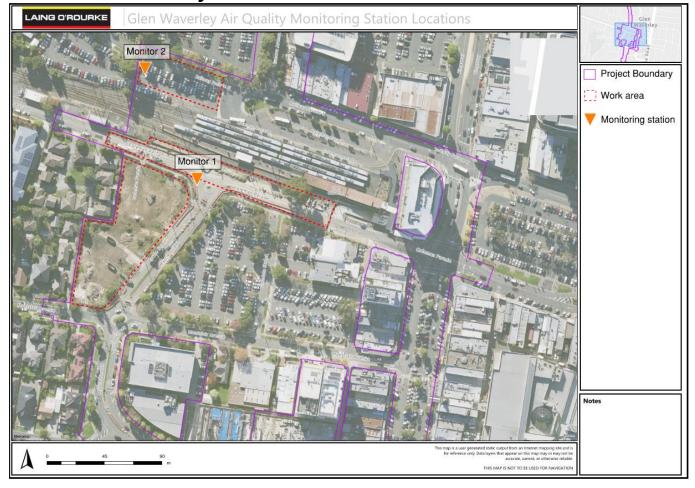


Figure 5: Glen Waverley air quality monitoring stations.

Table 6: Glen Waverley PM<sub>10</sub> results.

Monitor Number	Monitoring Location	Max Daily PM <sub>10</sub> Concentration (μg/m³)	Median Daily PM₁₀ Concentration (µg/m³)	Days TARP Implemented in the Month
-	Representative Background - Alphington	40.8	15.6	-
1	Coleman Parade	41.5	18.6	0
2	Railway Parade North	24.6	17.8	- 0

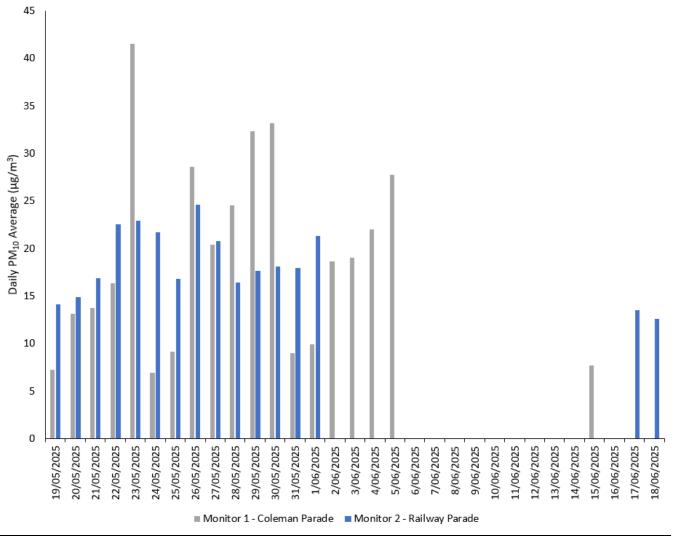


Figure 6: Glen Waverley PM<sub>10</sub> daily averages.

### 3.3.1. Analysis

The maximum daily average  $PM_{10}$  concentrations were 41.5  $\mu$ g/m³ (n = 19), and 24.6  $\mu$ g/m³ (n = 16) at the monitoring locations at Coleman Parade (Monitor 1) and Railway Parade (Monitor 2), respectively.

The TARP was not implemented during the reporting period. Water carts and hoses were used proactively to manage dust. Other dust management measures implemented on site included trucks covering loads prior to leaving site during spoil haulage. Stockpiles of soil and rock were maintained below the top of the hoarding to minimise the risk of dust leaving the site. Additionally, stockpiles and exposed surfaces were routinely dampened during worktimes to prevent dust.



# 3.4. Monash

No Early Works took place at Monash during the reporting period; therefore no monitoring was required.



# 3.5. Clayton

No Early Works took place at Clayton during the reporting period; therefore no monitoring was required.



# 3.6. Heatherton

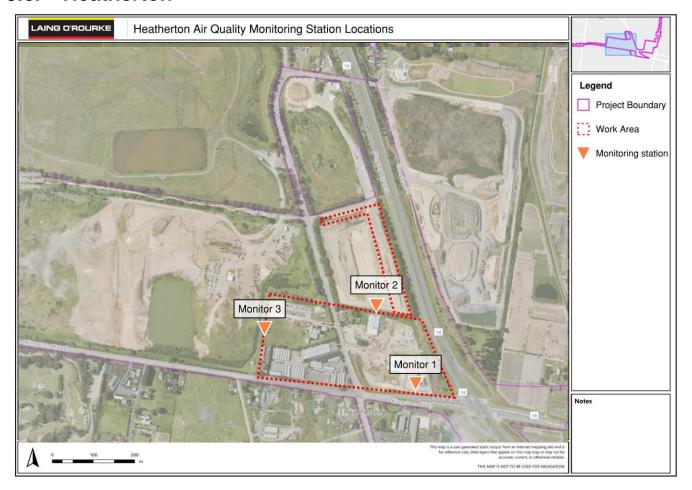


Figure 7: Heatherton air quality monitoring stations.

Table 7: Heatherton  $PM_{10}$  results.

Monitor Number	Monitoring Location	Max Daily PM₁₀ Concentration (μg/m³)	Median Daily PM₁₀ Concentration (µg/m³)	Days TARP Implemented in the Month
-	Representative Background - Dandenong	37.8	15.4	-
1	SSY - South	60.0	17.2	
2	Site Office	28.0	12.0	1
3	SS17	29.8	11.9	<del>-</del>

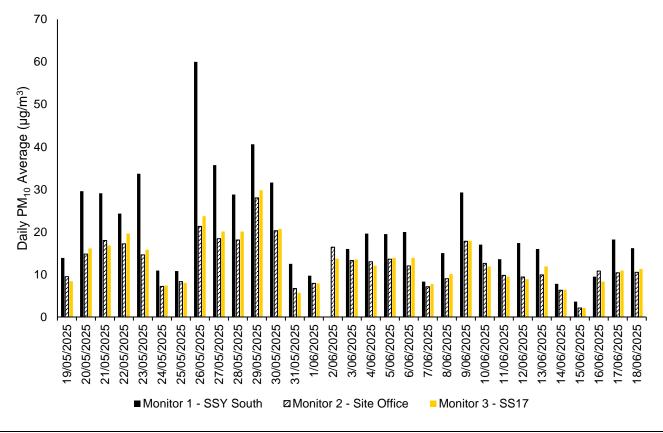


Figure 8: Heatherton PM<sub>10</sub> daily averages.

### 3.6.1. Analysis

This report does not include monitoring related to asbestos removal, which is monitored and reported separately. Monitoring for asbestos particles in the air has consistently found levels are within a safe and allowable range.

Throughout this reporting period there were a range of works being undertaken at the site, some of which are not subject to the reporting requirements of this document. These included earthworks associated with the Eastern Portal TAS and the safe removal of hazardous materials.

The maximum daily average  $PM_{10}$  concentrations were 60  $\mu$ g/m³ (n = 30), 28  $\mu$ g/m³ (n = 31), and 29.8  $\mu$ g/m³ (n = 31) at SSY South (Monitor 1), Site Office (Monitor 2), and SS17 (Monitor 3) respectively. The TARP was implemented on one day during the reporting period. Proactive controls were implemented such as water cart operation, soil binders on disused stockpiles and trucks with covered loads. The area was visually inspected throughout the day, and at no point was dust seen within the worksite boundary or leaving the site. Strong northerly wind conditions observed on the 26 May 2025 may have contributed to the observed spike in PM10 concentrations at Monitor 1 (refer to Figure 12).

Throughout the month, southerly winds likely caused high readings for the SSY South Monitor. These readings do not accurately reflect on-site conditions. The Heatherton site is in an industrial area with several neighbouring properties undertaking earthworks with large areas of exposed soil. On days where there are strong winds, airborne dust generated off-site has been observed to be blown onto the Heatherton site, contributing to elevated onsite monitoring results.



# 3.7. Cheltenham

No Early Works took place at Cheltenham during the reporting period; therefore no monitoring was required.



# 4. Meteorological Conditions

Table 8: Daily weather observations for Melbourne (Olympic Park), Victoria 19 May 2025 – 18 June 2025. Data Source BOM.


Statistic	Min Temperature (°C)	Max Temperature (°C)	Maximum Wind Gust Direction	Maximum Wind Gust Speed (km/h)	Relative Humidity @ 9:00 AM (%)
Mean	7.7	15.5	-	31.4	76.4
Lowest	2	11.8	S	15	46
Highest	12.7	20.4	NNW	56	100

Table 9: Daily weather observations for Melbourne (Moorabbin), Victoria 19 May 2025 – 18 June 2025. Data Source BOM.

Statistic	Min Temperature (°C)	Max Temperature (°C)	Maximum Wind Gust Direction	Maximum Wind Gust Speed (km/h)	Relative Humidity @ 9:00 AM (%)
Mean	6.8	15.7	-	38.6	76.2
Lowest	-0.4	12.7	SSW/SW	17.0	37.0
Highest	12.6	20.7	N	81.0	96.0

Table 10: Daily rain data for Melbourne (Olympic Park and Moorabbin), Victoria 19 May 2025 – 18 June 2025. Data Source BOM.

Statistic	Rain data Olympic Park (mm)	Rain data Moorabbin (mm)
Daily Low	0	0.0
Daily High	15.2	18.8
Total	43.20	50.2

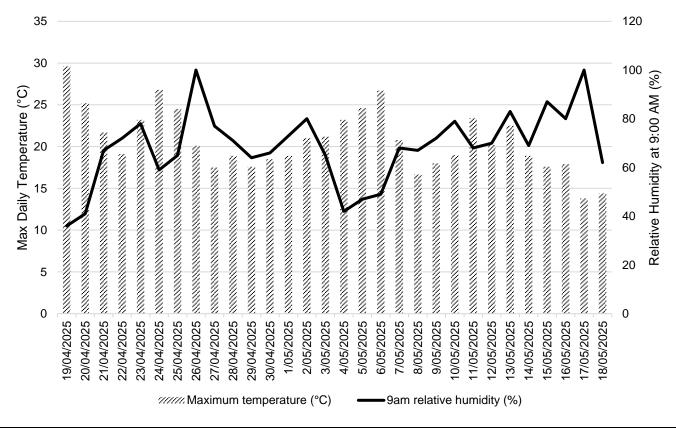

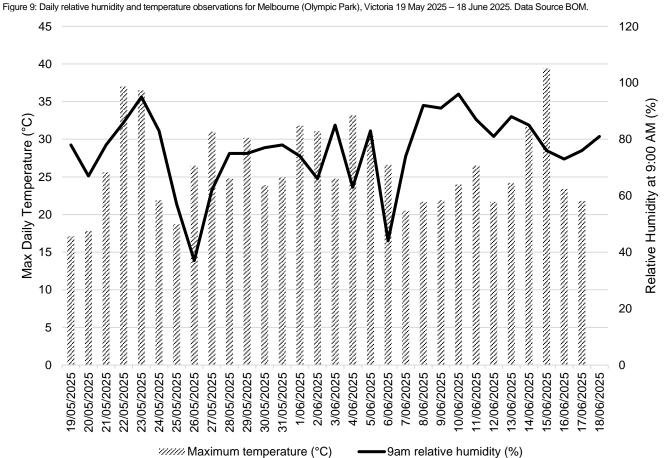


Figure 10: Daily relative humidity and temperature observations for Melbourne (Moorabbin), Victoria 19 May 2025 – 18 June 2025. Data Source BOM.

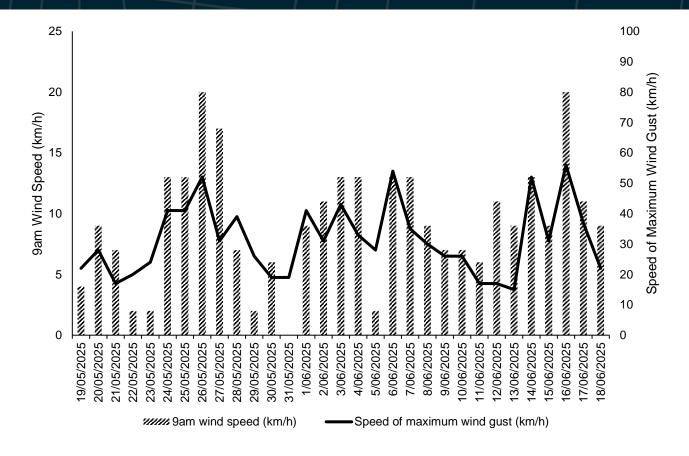


Figure 11: Daily wind speed observations for Melbourne (Olympic Park), Victoria 19 May 2025 – 18 June 2025. Data Source BOM.

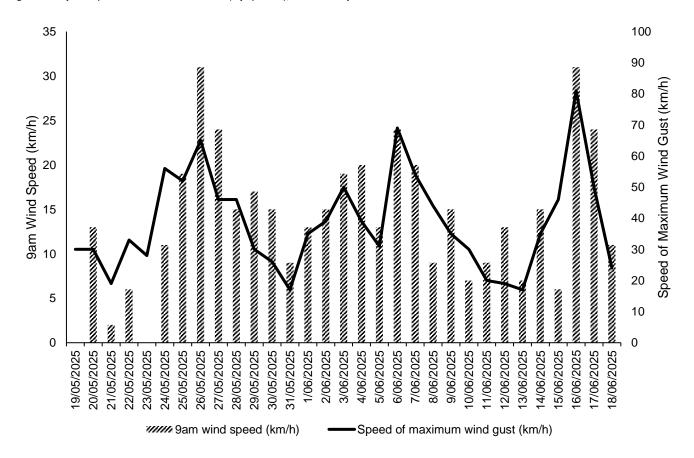


Figure 12: Daily wind speed observations for Melbourne (Moorabbin), Victoria 19 May 2025 – 18 June 2025. Data Source BOM.

# 5. Quality Assurance

### 5.1. Data Capture

Data capture is defined as the number of valid data periods collected divided by the number of available data periods. Valid data excludes period where the instrument is unavailable due to calibration and maintenance and excludes periods where the data has been rejected due to quality assurance/data validation procedures.

Data capture statistics for the reporting period 19 May 2025 to 18 June 2025 are shown in Table 11.

Data capture statistics were 100% for all parameters at all stations for the reporting period, except for the following:

- At Box Hill, there were no gaps in reporting data for Monitor 1 between 19 May 2025 and 18 June 2025.
- At Burwood, the gap in reporting data at Monitor 5 between 7 June 2025 and 10 June 2025, at Monitor 3 between 8 June 2025 and 18 June, and at Monitor 4 on the 18 June 2025 were due to battery issues, all of which have since been rectified. Further, Monitor 1 was replaced on 12 June 2025 as the previous monitor was due for calibration.
- At Glen Waverley, that gap in reporting data at Monitor 2 between 2 June 2025 and 16 June 2025, and at Monitor 1 between 6 June 2025 and 14 June 2025, and between 16 June 2025 and 18 June 2025 were all due to battery issues which have since been rectified.
- At Monash, all monitors have been decommissioned.
- At Clayton, all monitors have been decommissioned.
- At Heatherton, the gap in data of Monitor 1 on 2 June 2025 was due to a battery failure, requiring change out.
   Monitor 1 was back online on 3 June 2025.
- At Cheltenham, all monitors have been decommissioned.
- The construction program has been reviewed to ensure monitoring devices are installed prior to works. The MC is continuing to closely monitor the operation of the SiteHive units.

Table 11: Air quality monitoring, data capture summary

Location	Parameter	Averaging Period	Collected Periods	Available Periods	Data Capture
Box Hill – Site Office	PM <sub>10</sub>	24-hours	31	31	100%
Burwood – Corner of McComas Grove and Sinnott Street	PM <sub>10</sub>	24-hours	31	31	100%
Burwood – 16 McComas Grove	PM <sub>10</sub>	24-hours	31	31	100%
Burwood – Site 4 - West	PM <sub>10</sub>	24-hours	30	31	97%
Burwood – Site 4 - East	PM <sub>10</sub>	24-hours	20	31	65%
Burwood – Site 1 - South	PM <sub>10</sub>	24-hours	27	31	87%
Glen Waverley – Coleman Parade	PM <sub>10</sub>	24-hours	19	31	62%
Glen Waverley – Railway Parade	PM <sub>10</sub>	24-hours	16	31	52%
Heatherton – SSY – South	PM <sub>10</sub>	24-hours	30	31	97%
Heatherton – SSY – Site Office	PM <sub>10</sub>	24-hours	31	31	100%
Heatherton – SSY - SS17	PM <sub>10</sub>	24-hours	31	31	100%



# 5.2. Data Validation

Data contained in this report has been validated against performance and calibration requirements for each instrument.

Table 12: Monitoring device calibration information.

Location	Device Serial Number	Calibration Date	Calibration Due
Box Hill – Site Office	HEX-000407	29 Aug 2023	29 Aug 2025
Burwood – 16 McComas Grove	HEX-000162	22 August 2024	22 August 2026
Burwood – Corner of McComas Grove and Sinnott Street	HEX-000308 HEX-000300	3 Apr 2023 11 June 2025	3 Apr 2025 11 June 2027
Burwood – Site 4 - West	HEX-000489	6 Dec 2023	06 Dec 2025
Burwood – Site 4 – East	HEX-000541	24 Apr 2024	24 Apr 2026
Burwood – Site 1 South	HEX-000525	4 Mar 2024	4 Mar 2026
Glen Waverley – Coleman Parade	HEX-000477	12 Dec 2023	12 Dec 2025
Glen Waverley – Railway Parade	HEX-000528	4 Mar 2024	4 Mar 2026
Heatherton – SSY – South	HEX-000317	13 Dec 2023	13 Dec 2025
Heatherton – SSY – Site Office	HEX-000317	13 Dec 2023	13 Dec 2025
Heatherton – SSY - SS17	HEX-000499	5 March 2025	5 March 2027





# Suburban Rail Loop East Tunnels South Air Quality Monthly Report

19 May 2025 to 18 June 2025











### **Document Information**

Document Details	
Document Number	SRL-WPC-SCC-SPKW-REP-XEV-PWD-000011
Revision Date	7-Jul-2025
Revision Number	С

### **Revision Control**

Revision Number	Change Detail	Date	Comment
Α	Draft issued to SRLA	20/06/2025	Issued For Review
В	Draft issued to SRLA	27/06/2025	Issued For Review
С	Final issued to SRLA	07/07/2025	Final Report
	-		



# **Contents**

Execu	itive Summary	4
1	Introduction	8
1.1	SRL East	8
1.2	Environmental Management Framework	8
2	Air Quality Monitoring	9
2.1	Context	9
2.2	Purpose	9
2.3	Monitoring Locations	10
2.4	Data Limitations and Verification	11
3	Results	11
3.1	Train Stabling Facility West	12
3.1.1	Analysis	13
3.2	Clarinda CC01	14
3.2.1	Analysis	15
3.3	Clarinda Tunnel Access Structure Site	16
3.3.1	Analysis	17
3.4	Clayton Site	18
3.4.1	Analysis	19
3.5	Meteorological Conditions	20
4	Quality Assurance	21
4.1	Data Capture	21
4.2	Data Validation	22
	ary	
	•	
Ta	bles	
Table	1: Summary of air quality monitoring results	6
Table	2: Ambient air quality objectives for PM <sub>10</sub>	g
Table	3: Suburban Connect air quality monitoring locations active during reporting period	10
	4: Train Stabling Facility (TSF) West Site PM <sub>10</sub> Results	
	5: Clarinda CC01 PM <sub>10</sub> Results	
	6: Clarinda Tunnel Access Structure Site PM <sub>10</sub> Results	
	7: Clayton Site PM <sub>10</sub> Results	
	8: Daily weather observations for Moorabbin, Victoria	
	9: Daily rain data for Moorabbin, Victoria	
	10: Daily PM <sub>10</sub> Air Quality Monitoring Data Capture	
iable	11. Monitoring device campiation information	22



# **Figures**

Figure 1: Train Stabling Facility West site air quality monitoring station	12
Figure 2: Daily Averages PM <sub>10</sub> Results at Train Stabling Facility West	13
Figure 3: Clarinda CC01 air quality monitoring station	14
Figure 4: Daily Averages PM <sub>10</sub> Results at Clarinda CC01	15
Figure 5: Clarinda Tunnel Access Structure Site air quality monitoring station	16
Figure 6: Daily Averages PM10 Results at Clarinda Tunnel Access Structure Site	17
Figure 7: Clayton Site air quality monitoring station	18
Figure 8: Daily Averages PM <sub>10</sub> Results at Clayton	19
Figure 9: Daily relative humidity and temperature observations for Moorabbin, Victoria	20
Figure 10: Daily wind speed observations for Moorabbin, Victoria	21

# **Executive Summary**

### **Key Outcomes**

Key outcomes arising from the monthly air quality monitoring program:

- Works took place at:
  - o Train Stabling Facility West
  - Clarinda CC01
  - Clarinda Tunnel Access Structure Site
  - Clayton
- Visual air inspections were undertaken proactively to monitor and confirm there were no dust impacts
  due to works on site.
- All instances of elevated monitoring results were investigated and confirmed existing mitigation measures were sufficient to manage dust risks onsite.
- The TARP was not triggered during the reporting period.

Further explanation is provided in Section 3 regarding these observations.

### **Purpose of the Report**

This report presents the results of the monthly review of the air quality monitoring data for each Suburban Rail Loop (SRL) East main works construction site for the period between 19 May 2025 to 18 June 2025 in accordance with SRL East Environmental Management Framework (EMF) and Environmental Performance Requirements (EPRs) AQ1 and AQ2.

Suburban Connect is delivering the following scope of works as part of Suburban Rail Loop (SRL) East – Tunnels South:

- Initial launch of four Tunnel Boring Machines (TBM) from the Clarinda Tunnel Access Structure site
- Construction of approximately 16km of twin tube tunnels between Cheltenham and Glen Waverley







- Construction of 55 cross passages between the tunnels (surface-based ground improvement at eight locations with the remainder to be frozen from within the main tunnels)
- Construction of the western and eastern decline structures at the train stabling facility
- Protection of the South East Trunk Sewer (SETS)
- Box excavations at Clayton and Monash station locations
- Interface works with the Melbourne Metropolitan Rail Network (MMRN).

Suburban Connect is implementing an air quality monitoring program on each site that includes both visual observation and instrumental air quality monitoring. The purpose of the air quality monitors is to measure the concentration of small dust particles in the air near the construction site. These particles, known as PM<sub>10</sub> have the potential to impact human health. PM<sub>10</sub> refers to particles with an aerodynamic diameter of 10 μm or less.

This report compares the measured concentrations to air quality objectives that are defined in the Environment Reference Standard (ERS) which is a tool under the Environment Protection Act 2017. The ERS sets out the air quality objectives for PM<sub>10</sub> which are measured over a 24-hour averaging period. The objectives are risk-based concentrations that are not intended to be compliance levels, but they assist Suburban Connect understand the risk to human health. When the instrumental monitor and/or visual observations identify a change in site conditions this prompts Suburban Connect to take actions on site to reduce dust impacts, and review mitigation measures applied.

### Scope of Reporting

Construction works requiring air quality monitoring occurred at the following site/s during this reporting period:

- Train Stabling Facility West
- Clarinda CC01
- Clarinda Clarinda Tunnel Access Structure Site
- Clayton Clayton Site

There were no construction works requiring air quality monitoring at the following site/s during this reporting period:

- Cheltenham
- Train Stabling Facility East
- Monash
- Glen Waverley

This report does not include:

- works delivered as SRL Initial Works. The SRL Initial Works, which include investigative works are not subject to the EMF and EPRs.
- monitoring related to asbestos containing material removal works, which is monitored and reported separately.





### **Results**

The key findings are summarised in Table 1. An analysis of these findings is provided in Section 3.

Table 1: Summary of air quality monitoring results

Location	Parameter	Averaging Period	Max Concentration (µg/m³)	Median Concentration (µg/m³)	Days TARP Actions Implemented in the Month		
Representative Background Locations							
Dandenong	PM <sub>10</sub>	24-hour	37.8	15.4	N/A		
Suburban Connec	ct Monitoring Locat	ions					
Train Stabling Facility West – North West	PM <sub>10</sub>	24-hour	38.7	13.0	0		
Train Stabling Facility West – South East Boundary	PM <sub>10</sub>	24-hour	32.9	15.3	0		
Train Stabling Facility West – Linear Reserve North	PM <sub>10</sub>	24-hour	33.3	16.0	0		
Train Stabling Facility West – Linear Reserve South	PM <sub>10</sub>	24-hour	29.8	11.5	0		
Clarinda CC01	PM <sub>10</sub>	24-hour	30.9	13.6	0		
Clarinda Tunnel Access Structure - South Boundary	PM <sub>10</sub>	24-Hour	56.5	28.0	0		
Clarinda Tunnel Access Structure SiteEast	PM <sub>10</sub>	24-hour	59.3	30.2	0		
Clarinda Tunnel Access Structure Site - North	PM <sub>10</sub>	24-hour	38.4	16.0	0		
Clayton Site - Central	PM <sub>10</sub>	24-hour	35.9	10.7	0		







Location	Parameter	Averaging Period	Max Concentration (µg/m³)	Median Concentration (μg/m³)	Days TARP Actions Implemented in the Month
Clayton Site – North West	PM <sub>10</sub>	24-hour	34.9	13.4	0
Clayton Site – South	PM <sub>10</sub>	24-hour	32.9	18.6	0
Clayton Site – East	PM <sub>10</sub>	24-hour	24.2	19.0	0
Clayton Offsite – East	PM <sub>10</sub>	24-hour	20.2	12.6	0



# 1 Introduction

### 1.1 SRL East

Suburban Rail Loop (SRL) will deliver a 90km rail line linking every major suburban line from the Frankston Line to the Werribee Line via Melbourne Airport, better connecting Victorians to jobs, retail, education, health services and each other. Construction of SRL East from Cheltenham to Box Hill is underway and will connect major employment, health, education and retail destinations in Melbourne's east and south-east. The new underground train line will reduce travel times, connect people travelling on the Gippsland corridor and building it will create up to 8000 direct local jobs. Trains will be running by 2035.

The SRL East – Tunnels South scope of works include:

- Initial launch of four Tunnel Boring Machines (TBM) from the Clarinda Tunnel Access Structure site
- Construction of approximately 16km of twin tube tunnels between Cheltenham and Glen Waverley
- Construction of 55 cross passages between the tunnels (surface-based ground improvement at eight locations with the remainder to be frozen from within the main tunnels)
- · Construction of the western and eastern decline structures at the train stabling facility
- Protection of the South East Trunk Sewer (SETS)
- Box excavations at Clayton and Monash station locations
- Interface works with the Melbourne Metropolitan Rail Network (MMRN).

This report does not include works delivered as SRL Initial Works. The SRL Initial Works, which includes investigative works, were subject to a separate approval process under Clause 52.30 of the VPP and were approved by the Minister for Planning on 19 December 2021. These works are required to comply with Clause 52.30 of the VPP and are not subject to the EMF and EPRs.

### 1.2 Environmental Management Framework

The Environmental Management Framework (EMF) for SRL East (the Project) provides a transparent and integrated framework to manage environmental effects of the Project and includes EPRs that define environmental outcomes that must be achieved during the design, construction, and operation phases of the Project. The EMF is available on the SRL east website at <a href="https://bigbuild.vic.gov.au/library/suburban-rail-loop/planning/srl-east-environmental-management-framework">https://bigbuild.vic.gov.au/library/suburban-rail-loop/planning/srl-east-environmental-management-framework</a>.

The development of the EMF has been informed by relevant legislation, policy and guidelines, and the specialist impact assessment studies completed for the SRL East Environment Effects Statement (EES) and the Minister's Assessment, dated 5 August 2022.

The EMF requires the Principal Contractor (PC) to develop and implement an Environmental Air Quality and Dust Management Plan (EAQDMP). As part of implementing this document plan, the PC is required to conduct monitoring of PM<sub>10</sub> concentrations and measure wind speed and direction at each Early Works construction site and at a representative control site. The EAQDMP also includes a Trigger Action Response Protocol (TARP) which defines a set of triggers that prompt actions on site to reduce dust impacts, and review mitigation measures applied.

The PC regularly reviews the monitoring data at each site, for the purpose of assessing the effectiveness of EAQDMP implementation. The verified results of the PM<sub>10</sub> monitoring for the applicable monthly period are contained in this report, which will be available to the public, in accordance with the requirements of the EMF.



# 2 Air Quality Monitoring

#### 2.1 Context

Maintaining air quality is important for public health, the liveability of our cities and our environment. Overall air quality conditions in Melbourne are good, however like all major cities, there are days where the background concentrations of air pollutants are very high on a regional basis. Sometimes these elevated concentrations are due to regional influences such as windblown continental dust, bushfires or hazard reduction burns. Emissions from traffic, home heating, and industrial emissions across Melbourne can also cause high background concentrations, especially when the weather is calm. Environment Protection Authority (EPA) monitoring stations measure these background levels of pollution that already exist in the air within the surrounding area. The EPA monitoring station at Dandenong is used as the representative control site for Suburban Connect work sites.

Without effective management, construction of the Project has the potential to contribute to these background concentrations which may impact public health. Comparison of SRL East monitoring results with publicly available EPA monitoring data is used by the PC to identify when construction-related activities are impacting local air quality, and conversely when the local air quality results may be influenced by background conditions outside of the influence of the construction site.

Meteorological conditions, such as wind direction and speed, can impact on the dispersion of particulates in the air and by monitoring these, the PC can respond when conditions on site change. Having records of wind conditions is also helpful for retrospectively identifying the activity that is causing any elevated dust concentrations.

#### 2.2 Purpose

The purpose of the air quality monitors is to measure the concentration of small dust particles in the air near the construction site. These particles, known as  $PM_{10}$  have the potential to impact human health.  $PM_{10}$  refers to particles with an aerodynamic diameter of 10  $\mu$ m or less.

The measured concentrations are compared to air quality objectives that are defined in the Environment Reference Standard (ERS) which is a tool under the Environment Protection Act 2017. The air quality objectives defined in the ERS informed the objectives for air quality for the Project, noting that the ambient air ERS is not a compliance standard that one can pollute up to. The ERS does not provide an indicator or objective for nuisance dust.

The objectives are risk-based concentrations that are not intended to be compliance levels, but they assist the PC to understand the risk to human health. The ERS sets out the air quality objectives for PM<sub>10</sub> which are measured over a 24-hour averaging period, as reproduced below in Table 2.

Table 2: Ambient air quality objectives for PM<sub>10</sub>

Indicator	Air Quality Objective (μg/m³)	Averaging Period
Indicator Particles as PM <sub>10</sub> (maximum concentration)	50	24-hour

The measured concentrations (which include both existing background concentrations and the Project's incremental contribution over a 24-hour period) are presented in Section 3 and compared against the air quality objective. Monitoring is continuous, even when there are no construction-related activities occurring on the site. Periods of time where there are no site activities are classified as 'Out of Hours'. The potential for





dust generation from the work sites is much lower when there are no site activities occurring, however dust can still be generated at the work site during 'Out of Hours' periods due to wind erosion.

## 2.3 Monitoring Locations

Air quality monitors are located on or adjacent to the construction sites, to represent local air quality conditions, in positions that enable the PC to adequately measure potential impact of works on local sensitive receivers including residents.

The air quality monitors were installed on the following dates at each of the following locations. The location of these monitors are shown on maps in Section 3 of this report.

Latitude and longitude coordinates of monitoring equipment are sourced directly from the monitoring equipment management system and locations may differ between reporting periods due to variance in GPS readings.

Table 3: Suburban Connect air quality monitoring locations active during reporting period

Monitoring Location	Date Commissioned	Coordinates	Monitoring Parameters	Representative Control Site
Train Stabling Facility West – North West	7 May 2025	Latitude: -37.9524° Longitude: 145.0927°	PM <sub>10</sub>	Dandenong EPA monitoring station
Train Stabling Facility West – South East	8 May 2025	Latitude: 37.9548° Longitude: 145.0923°	PM <sub>10</sub>	Dandenong EPA monitoring station
Train Stabling Facility West – Linear Reserve North	15 May 2025	Latitude: -37.9529° Longitude: 145.0884°	PM <sub>10</sub>	Dandenong EPA monitoring station
Train Stabling Facility West – Linear Reserve South	15 May 2025	Latitude: -37.9539° Longitude: 145.0883°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clarinda CC01	24 Oct 2024	Latitude: -37.9558° Longitude: 145.1063°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clarinda Tunnel Access Structure Site – South Boundary	21 Feb 2025	Latitude: -37.9563° Longitude: 145.1093°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clarinda Tunnel Access Structure Site – East Boundary	3 Dec 2024	Latitude: -37.9563° Longitude: 145.1109°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clarinda Tunnel Access Structure Site – North	23 Jan 2025	Latitude: -37.9554° Longitude: 145.1089°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clayton Site - Central	21 May 2025	Latitude: -37.92131° Longitude: 145.1198°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clayton Site – North West	3 Dec 2024	Longitude: -37.9215° Latitude: 145.1194°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clayton Site - South	5 Mar 2025	Latitude: -37.9235° Longitude: 145.1193°	PM <sub>10</sub>	Dandenong EPA monitoring station







Clayton Site - East	3 Dec 2024	Latitude: -37.9221° Longitude: 145.1204°	PM <sub>10</sub>	Dandenong EPA monitoring station
Clayton Offsite - East	04 Jun 2025	Latitude: -37.92232° Longitude: 145.1207°	PM <sub>10</sub>	Dandenong EPA monitoring station

#### 2.4 Data Limitations and Verification

The following limitations apply to this data:

- Meteorological conditions on site can affect measurements made by monitoring devices. For instance, dust measurements can be impacted by rainfall, fog and/or humidity (with water droplets in the air being mistaken as dust particles). Displaying periods of inclement weather allows reviewers to identify measurements that may have been impacted.
- Breaks in data availability may occur due to sensor outages, instrument errors, technical issues, or removal of sensors during non-working periods to ensure the security of the equipment.
- Proximity of site monitors to public roads, industrial businesses and other factors will impact data recording.
- Monitors may need to be located close to works due to security requirements.
- Monitor locations will change as works progress and construction activity locations change.

Data has been provided in tabular and graphical form in Section 3 to visually present 24-hour averages of PM<sub>10</sub> over the monthly period. The data included in this report has been verified by the Suburban Connect and relevant subject matter experts.

## 3 Results

Data has been presented in graphical form below to visually present 24-hour averages of PM<sub>10</sub> dust concentration over the monthly period for each active construction site.



#### **Train Stabling Facility West** 3.1

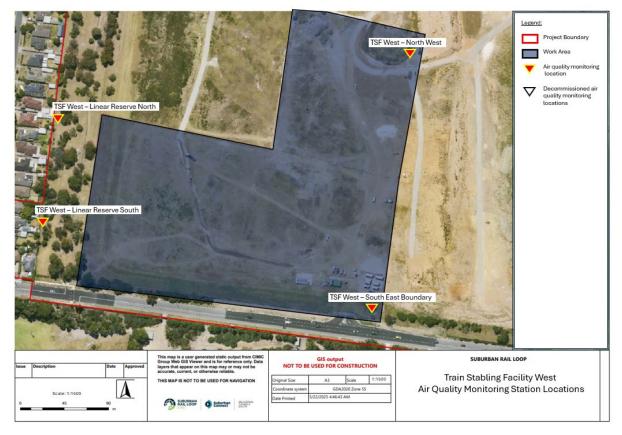


Figure 1: Train Stabling Facility West site air quality monitoring station

Table 4: Train Stabling Facility (TSF) West Site PM<sub>10</sub> Results

Monitor Number	Monitoring Location	Max Daily PM₁₀ Concentration (μg/m³)	Median Daily PM <sub>10</sub> Concentration (μg/m³)	Days TARP Actions Implemented in the Month
-	Representative Background – Dandenong	37.8	15.4	-
1	North West	38.7	13.0	0
2	South East	32.9	15.3	0
3	Linear Reserve North	33.3	16.0	0
4	Linear Reserve South	29.8	11.5	0



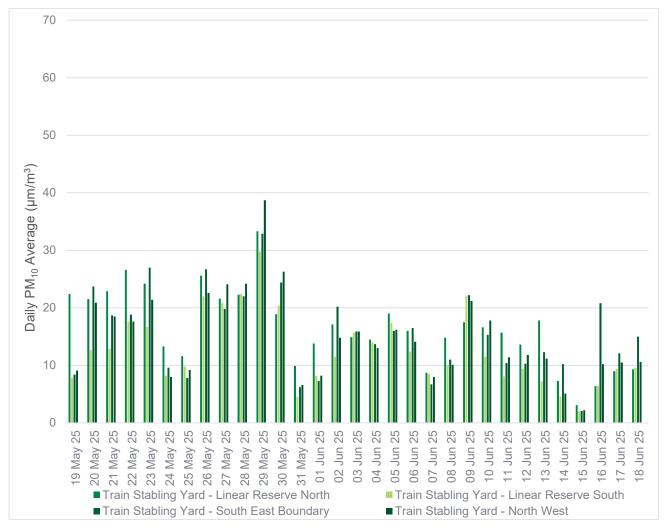


Figure 2: Daily Averages PM<sub>10</sub> Results at Train Stabling Facility West

#### 3.1.1 Analysis

Water carts were used proactively on site when works were occurring. The existing mitigation measures were sufficient to manage dust onsite, there were no elevated PM<sub>10</sub> events and the TARP was not implemented during the reporting period.



## 3.2 Clarinda CC01



Figure 3: Clarinda CC01 air quality monitoring station

Table 5: Clarinda CC01 PM<sub>10</sub> Results

Monitor Number	Monitoring Location	Max Daily PM <sub>10</sub> Concentration (μg/m³)	Median Daily PM <sub>10</sub> Concentration (μg/m³)	Days TARP Actions Implemented in the Month
-	Representative Background – Dandenong	37.8	15.4	-
1	Clarinda CC01 – nearest residential property	30.9	13.6	0





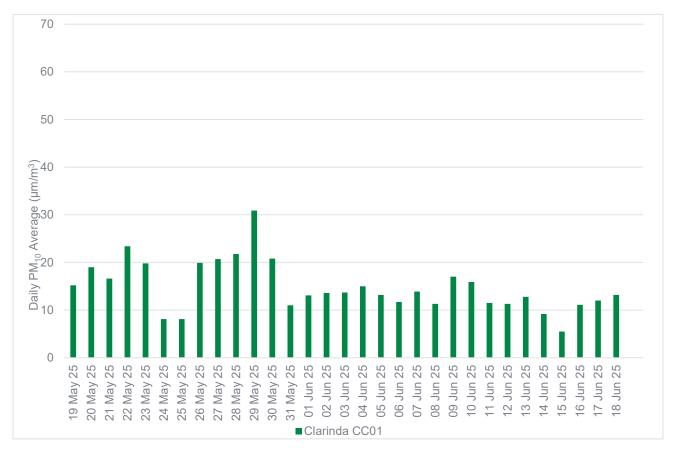


Figure 4: Daily Averages PM<sub>10</sub> Results at Clarinda CC01

### 3.2.1 Analysis

The existing mitigation measures were sufficient to manage dust onsite. There were no elevated PM<sub>10</sub> events, and the TARP was not implemented during the reporting period.



#### 3.3 Clarinda Tunnel Access Structure Site



Figure 5: Clarinda Tunnel Access Structure Site air quality monitoring station

Table 6: Clarinda Tunnel Access Structure Site PM<sub>10</sub> Results

Monitor Number	Monitoring Location	Max Daily PM₁₀ Concentration (µg/m³)	Median Daily PM₁₀ Concentration (µg/m³)	Days TARP Actions Implemented in the Month
-	Representative Background – Dandenong	37.8	15.4	-
1	Clarinda - Tunnel Access Structure Site – North Boundary	38.4	16.0	0
2	Clarinda - Tunnel Access Structure Site – East Boundary	59.3	30.2	0
3	Clarinda – Tunnel Access Structure Site – South Boundary	56.5	28.0	0





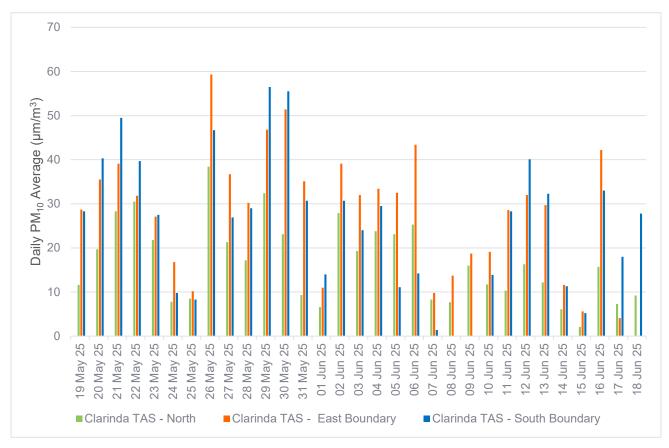


Figure 6: Daily Averages PM10 Results at Clarinda Tunnel Access Structure Site

#### 3.3.1 Analysis

There were two days (8 and 9 June) where the Clarinda TAS – East Boundary monitor required servicing, therefore  $PM_{10}$  data was not recorded for this period. No works occurred over this period due to site shut down (King's Birthday Public Holiday). The unit was serviced on 10 June following the shutdown period and has since had no interruptions.

All elevated  $PM_{10}$  levels were investigated and attributed external off-site sources. The daily elevated levels on the 21, 29 and 30 May match the south-westerly wind, which is in line with the data. The daily exceedance on the 26 May was attributed to offsite activities blowing dust across site with a northerly wind. Therefore no additional TARP actions were required for all elevated  $PM_{10}$  levels.

Dust is mitigated by a boundary sprinkler system, two dedicated water carts, rumble grids at entry and exit points, and street sweepers. In addition, daily observations by supervisors and environmental representatives are performed to respond to areas of concern.

Visual air inspections were also undertaken to proactively monitor and confirm there were no off-site dust impacts due to construction activities on site.



## 3.4 Clayton Site



Figure 7: Clayton Site air quality monitoring station

Table 7: Clayton Site PM<sub>10</sub> Results

Monitor Number	Monitoring Location	Max Daily PM₁₀ Concentration (µg/m³)	Median Daily PM <sub>10</sub> Concentration (μg/m³)	Days TARP Actions Implemented in the Month
-	Representative Background – Dandenong	37.8	15.4	-
1	Clayton Site - Central	35.9	10.7	0
2	Clayton Site – North West	34.9	13.4	0
3	Clayton Site – South	32.9	18.6	0
4	Clayton Site – East	24.2	19.0	0
5	Clayton Offsite – East	20.2	12.6	0





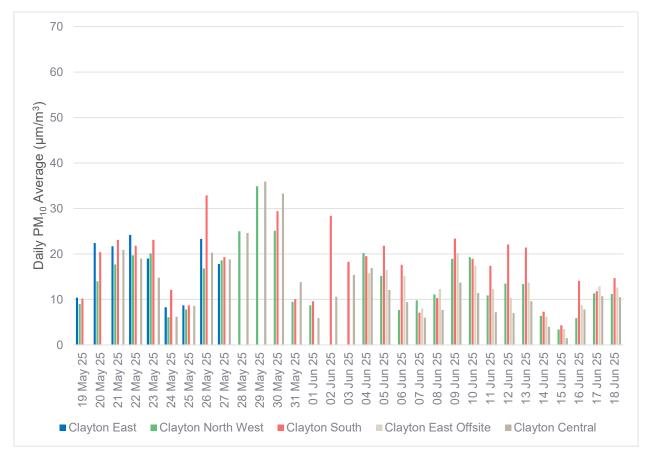


Figure 8: Daily Averages PM<sub>10</sub> Results at Clayton

#### 3.4.1 Analysis

There were two instances where monitoring devices were offline due to low battery. Clayton South was offline for two days (28<sup>th</sup> and 29<sup>th</sup> May) and Clayton North West was offline for two days (2<sup>nd</sup> and 3<sup>rd</sup> June). The batteries of these devices were replaced and have been active since.

The Clayton East monitor was removed on 28 May to enable works on site. The monitor was then relocated to an offsite location east of Clayton Site and the new monitoring location Clayton Offsite – East was established on 3 June. Monitor has remained active since.

A new monitoring site was established at Clayton Central on 21 May.

There were no elevated  $PM_{10}$  monitoring events during the reporting period. Regular dust suppression activities, including the use of water carts and street sweepers, were employed to control dust. No additional TARP actions were required.

Visual air inspections were also undertaken to proactively monitor and confirm there were no off-site dust impacts due to works on site.



## 3.5 Meteorological Conditions

Table 8: Daily weather observations for Moorabbin, Victoria

Statistic	Min Temperature (°C)	Max Temperature (°C)	Maximum Wind Gust Direction	Maximum Wind Gust Speed (km/h)	Relative Humidity @ 9:00 AM (%)
Mean	6.8	15.7	N/A	38.6	76.2
Lowest	-0.4	12.7	SW	17	37.0
Highest	12.6	20.7	N	81	96.0

Table 9: Daily rain data for Moorabbin, Victoria

Statistic	Rain (mm)
Daily Low	0.0
Daily High	18.8
Total	50.0

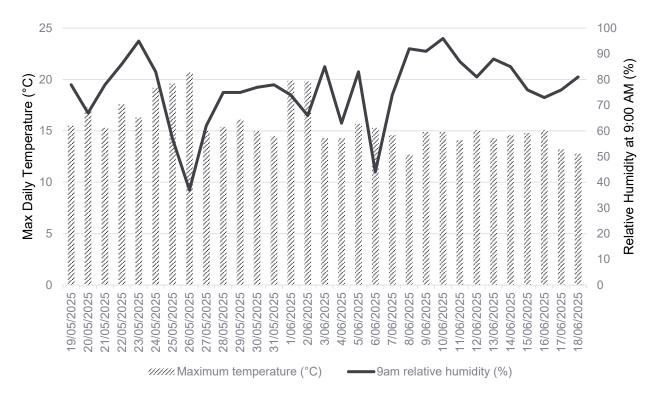


Figure 9: Daily relative humidity and temperature observations for Moorabbin, Victoria



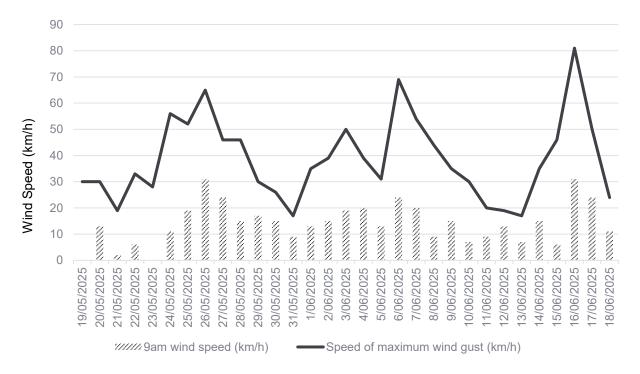


Figure 10: Daily wind speed observations for Moorabbin, Victoria

## 4 Quality Assurance

## 4.1 Data Capture

Data capture is defined as the number of valid data periods collected divided by the number of available data periods. Valid data excludes period where the instrument is unavailable due to calibration and maintenance and excludes periods where the data has been rejected due to quality assurance/data validation procedures. Data capture statistics for the reporting period 19 May 2025 to 18 June 2025 are shown below.

Table 10: Daily PM<sub>10</sub> Air Quality Monitoring Data Capture

Location	Available Periods	Collected Periods	Data Capture	Details
Train Stabling Facility West – North West	31	31	100%	There were no interruptions to monitoring at this location during the reporting period
Train Stabling Facility West – South East Boundary	31	31	100%	There were no interruptions to monitoring at this location during the reporting period
Train Stabling Facility West – Linear Reserve North	31	31	100%	There were no interruptions to monitoring at this location during the reporting period
Train Stabling Facility West –	31	31	100%	There were no interruptions to monitoring at this location during the reporting period





Location	Available Periods	Collected Periods	Data Capture	Details
Linear Reserve South				
Clarinda – CC01	31	31	100%	There were no interruptions to monitoring at this location during the reporting period
Clarinda Tunnel Access Structure Site – South Boundary	31	29	94%	Monitor required maintenance and was out of operation 08/06 to 09/06, once monitor was serviced no interruptions occurred.
Clarinda Tunnel Access Structure Site – East Boundary	31	31	100%	There were no interruptions to monitoring at this location during the reporting period
Clarinda Tunnel Access Structure Site – North	31	31	100%	There were no interruptions to monitoring at this location during the reporting period
Clayton Site – Central	29	29	100%	Monitoring location established on 21/05. Had no interruptions following.
Clayton Site – North West	31	29	94%	Battery died for a period of 2 days, once battery was replaced no interruptions occurred.
Clayton Site - South	31	29	94%	Battery died for 2 days, once battery was replaced no interruptions occurred.
Clayton Site – East	9	9	100%	Monitor was removed from site on 28/05, then relocated to Clayton Offsite – East on 04/06 and had no interruptions following relocation.
Clayton Offsite - East	15	15	100%	Monitoring location established on 04/06 and has since had no interruptions.

#### 4.2 Data Validation

Data contained in this report has been validated against performance and calibration requirements for each instrument. Data during commissioning, maintenance and calibration periods has been removed from the validated data sets.

Table 11: Monitoring device calibration information

Location	Device Serial Number	Calibration Date	Calibration Due
Train Stabling Facility West – North West	HEX-000418	17 Feb 2025	17 Feb 2027
Train Stabling Facility West – South East Boundary	HEX-000498	20 Sep 2024	20 Sep 2026
Train Stabling Facility West– Linear Reserve North	HEX-000706	19 Feb 2025	19 Feb 2027





Location	Device Serial Number	Calibration Date	Calibration Due
Train Stabling Facility West – Linear Reserve South	HEX-000795	18 Dec 2025	18 Dec 2027
Clarinda CC01 – Nearest Residential property	HEX-000626	19 Feb 2025	19 Feb 2027
Clarinda Tunnel Access Structure Site – South Boundary	HEX-000348	19 Feb 2025	19 Feb 2027
Clarinda Tunnel Access Structure Site – East Boundary	HEX-000780	18 Dec 2024	18 Dec 2026
Clarinda Tunnel Access Structure Site – North	HEX-000791	18 Dec 2024	18 Dec 2026
Clayton – Central	HEX-000203	19 Mar 2025	19 Mar 2027
Clayton – East	HEX-000705	24 Oct 2024	24 Oct 2026
Clayton Offsite – East	HEX-000705	24 Oct 2024	24 Oct 2026
Clayton – North West	HEX-000623	19 Feb 2025	19 Feb 2027
Clayton – South	HEX-000744	27 Nov 2024	27 Nov 2026





# **Glossary**

Term / Abbreviation	Definition	
µg/m³	micrograms per cubic metre is a unit of measurement used to measure the mass of air pollutants (micrograms) per volume of air (cubic metre) as a concentration.	
EAQDMP	The Environmental Air Quality and Dust Management Plan (EAQDMP) is environmental management documentation prepared by the PC to manage and monitor air quality impacts during construction of SRL East. It includes the RMMP and TARP and is verified by the IEA.	
EES	Environment Effects Statement (EES) in Victoria, environment assessment of the potential environmental impacts or effects of a proposed development under the Environment Effects Act 1978.	
EMF	The Environmental Management Framework (EMF) provides a transparent and integrated framework to manage environmental effects of the SRL East Project during construction and operation to achieve acceptable environmental outcomes.	
EPA	Environment Protection Authority (EPA) is the Victorian regulator established under the Environment Protection Act 2017 and which has the statutory objective to protect human health and the environment from the harmful effects of pollution and waste.	
EPRs	The Environmental Performance Requirements (EPRs) define the environmental outcomes that must be achieved during the design, construction and operation of SRL East and are included within the EMF.	
ERS	The Environmental Reference Standard (ERS) is a tool made under the Environment Protection Act 2017 to identify and assess environmental values, including air quality, in Victoria.	
IEA	The Independent Environmental Auditor (IEA) is appointed by the Victorian Government to undertake independent environmental reviews and audits of project activities including assessing compliance with the EMF and EPRs.	
PC	Principal Contractor	
PM <sub>10</sub>	Particulate matter with an aerodynamic diameter of 10 micrometres ( $\mu$ m) or less. PM <sub>10</sub> particles are small enough to have a potential impact on human health.	
RMMP	The Risk Management and Monitoring Program (RMMP) plan outlines the approach to air quality monitoring and includes instrumental, visual monitoring, TARP and public reporting processes. The RMMP forms part of the EAQDMP.	
TARP	The Trigger Action Response Protocol (TARP) defines a series of adaptive management measures that are implemented to avoid or mitigate impacts from dust emissions for nearby sensitive receptors in response to the results from monitoring. The TARP forms part of the EAQDMP	